

Access Compliance Report Public Rights-of-Way (Curb Ramps)




13.6

Intersection ID: 10037049 Main Street: S_TRYON_ST Cross Street: N/A Location: NW

ADA ID: 5C7D5A53DABD Ramp Type: BlendTrans2 Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 33.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

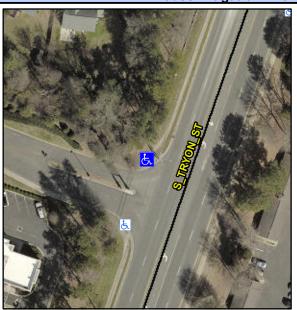

Street 1 Name ENTRANCE
Stop Condition-Street 1 StopSign
Street 2 Name STRYON ST
Stop Condition-Street 2 None

Possible Solutions:

Remove & Replace Curb Ramp With
Two New Directional Ramps or
Equivalent.

Surveyor Notes:
N/A

PROW/ADA:
Not Found, R304.5.1, R304.5.3

Total Cost: \$ 3200.00

Compliance Description Data Compliance Description Data Yes N/A Ramp Length (in) 139.0 BlendTrans Slope (%) 3.3 39.0 No No Ramp Width (in) BlendTrans XSlope (%) 7.0 N/A N/A Flare Type LT N/A Flare Type RT N/A N/A Flare Slope LT (%) N/A N/A Flare Slope RT (%) N/A N/A Flare Traversable LT? N/A N/A Flare Traversable RT? N/A N/A N/A N/A **DWS Provided?** N/A Landing Length (in) N/A Landing Width (in) N/A N/A **DWS Contrast?** N/A N/A N/A N/A Landing Slope (%) DWS Length (in) N/A N/A Landing X Slope (%) N/A N/A DWS Full Width? N/A N/A Landing Curb? (Y/N) N/A N/A DWS Offset (in) N/A N/A N/A Shared Landing? N/A **Gutter Ponding?** N/A N/A Gutter Slope (%) N/A N/A Gutter Lip Ht (in) N/A N/A Gutter X Slope (%) N/A N/A Painted X Walk1? No N/A Painted X Walk2? No X Walk 1 Direction To S X Walk 2 Direction To E N/A X Walk 1 Width (in) X Walk 2 Width (in) N/A X Walk 1 Slope (%) 4.7 X Walk 2 Slope (%) 1.4 X Walk 2 X Slope (%) X Walk 1 X Slope (%) 1.5 3.3 N/A N/A Ramp inside XWalk2? N/A N/A Ramp inside XWalk1? Road Slope (%) 0.0 Clear Space? N/A N/A Road X Slope (%) Clear Space to XWalk (in) N/A 6.0 N/A N/A N/A Any Obstructions? Storm Grate/Utility Hazard? N/A Obstruction Type Storm Grate/Utility Type N/A N/A Yes Surface Condition? (G/P) Good

No

Curb Slope (%)





