


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

|                                         |                                         |                                         |                        |
|-----------------------------------------|-----------------------------------------|-----------------------------------------|------------------------|
| Intersection ID: 11540                  | Main Street: W MARTIN LUTHER KING JR BV | Access Street: S SUMMIT AV              | Location: E            |
| ADA ID: 61056EBB1C21                    | Ramp Type: Directional                  | Initial Pass/Fail: Pass                 | Overall Compliance: No |
| Severity Score: 17.5                    |                                         |                                         |                        |
| Codes/Mitigation Info/Possible Solution |                                         | Field Measurements/Component Compliance |                        |

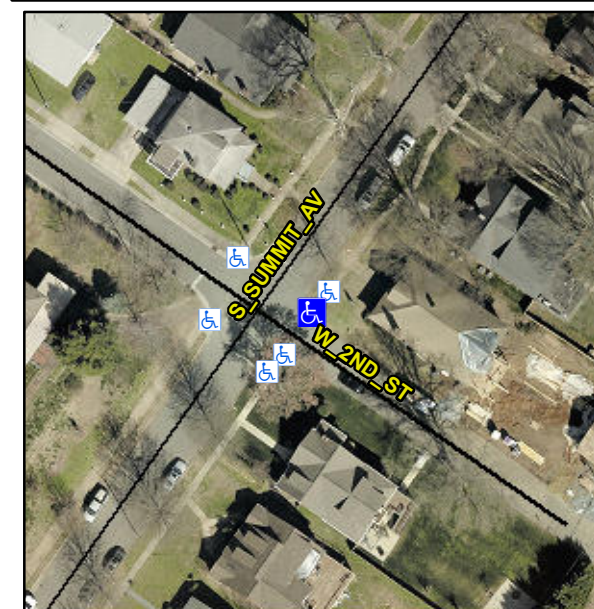

Possible Solutions:

**Remove & Replace Entire Ramp.  
Grind Gutter Lip.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.2.2-Perp, R304.3.2-Para,  
R304.5.2, R305, R302.7.2**

Total Cost: \$ 1800.00

| Compliance | Description           | Data  | Compliance | Description                 | Data |
|------------|-----------------------|-------|------------|-----------------------------|------|
| N/A        | Ramp Length (in)      | 61.0  | No         | Grade Break?                | No   |
| Yes        | Ramp Width (in)       | 49.5  | N/A        | Grade Break Slope (%)       | N/A  |
| Yes        | Ramp Slope (%)        | 6.4   | N/A        | Grade Break XSlope (%)      | N/A  |
| Yes        | Ramp XSlope (%)       | 0.6   |            |                             |      |
| N/A        | Flare Type LT         | N/A   | N/A        | Flare Type RT               | N/A  |
| N/A        | Flare Slope LT (%)    | N/A   | N/A        | Flare Slope RT (%)          | N/A  |
| N/A        | Flare Traversable LT? | N/A   | N/A        | Flare Traversable RT?       | N/A  |
| Yes        | Landing Length (in)   | 61.0  | No         | DWS Provided?               | No   |
| Yes        | Landing Width (in)    | 48.0  | N/A        | DWS Contrast?               | No   |
| No         | Landing Slope (%)     | 4.7   | N/A        | DWS Length (in)             | N/A  |
| Yes        | Landing X Slope (%)   | 0.1   | N/A        | DWS Full Width?             | No   |
| N/A        | Landing Curb? (Y/N)   | N/A   | N/A        | DWS Offset LT (in)          | N/A  |
| N/A        | Shared Landing?       | Yes   | N/A        | DWS Offset RT (in)          | N/A  |
| Yes        | Gutter Ponding?       | No    | Yes        | Gutter Slope (%)            | 1.4  |
| No         | Gutter Lip Ht (in)    | 0.5   | Yes        | Gutter X Slope (%)          | 1.7  |
| N/A        | Painted X Walk1?      | No    |            | Road Slope (%)              | 1.8  |
|            | X Walk 1 Direction    | To SW |            | Road X Slope (%)            | 2.7  |
|            | X Walk 1 Width (in)   | N/A   |            | Clear Space?                | Yes  |
|            | X Walk 1 Slope (%)    | 1.8   | N/A        | Clear Space to XWalk (in)   | N/A  |
|            | X Walk 1 X Slope (%)  | 2.7   | Yes        | Storm Grate/Utility Hazard? | No   |
| N/A        | Ramp inside XWalk1?   | N/A   |            | Storm Grate/Utility Type    |      |
| Yes        | Any Obstructions?     | No    |            |                             | N/A  |
|            | Obstruction Type      |       | Yes        | Surface Condition? (G/P)    | Good |
|            |                       |       | N/A        | Curb Slope (%)              | 0.8  |

Street 1 Name MARTIN LUTHER LING JR BV  
 Stop Condition-Street 1 StopSign  
 Street 2 Name N/A  
 Stop Condition-Street 2 N/A

