

## **Access Compliance Report Public Rights-of-Way** (Curb Ramps)



Data

7.7

0.0

N/A

Good

Main Street: WHITEHALL\_EXECUTIVE\_CENTERS SDStreet: N/A Intersection ID: 10041624 Location: NE

**Overall Compliance: No** ADA ID: 68E915729041 Ramp Type: Perp Initial Pass/Fail: Fail **Severity Score:** 8.75

## **Codes/Mitigation Info/Possible Solution**

## Field Measurements/Component Compliance

Yes

Yes

N/A

Yes

Compliance Description

Ramp Slope (%)

Flare Type RT

Ramp XSlope (%)

Flare Slope RT (%)

DWS Provided?

**DWS Contrast?** 

DWS Length (in)

DWS Full Width?

DWS Offset (in)

Gutter Slope (%)

Gutter X Slope (%)

Painted X Walk2?

X Walk 2 Direction

X Walk 2 Width (in)

X Walk 2 Slope (%)

X Walk 2 X Slope (%)

Ramp inside XWalk2?

Clear Space to XWalk (in)

Storm Grate/Utility Hazard?

Storm Grate/Utility Type

Surface Condition? (G/P)

Clear Space?

Flare Traversable RT?

Data

94.0

41.0

N/A

No

To S

N/A

3.3

0.5


N/A

N/A

N/A

N/A

N/A

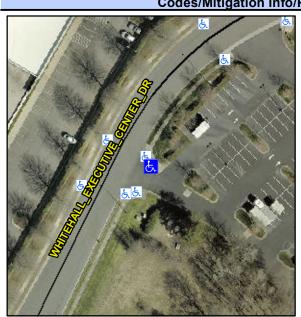

**ENTRANCE** Street 1 Name Stop Condition-Street 2 None N/A Street 2 Name Stop Condition-Street 1 N/A Possible Solutions: Compliance Description N/A Remove & Replace Entire Ramp. No N/A N/A N/A N/A Surveyor Notes: N/A N/A N/A N/A N/A N/A PROW/ADA: N/A Not Found, R304.5.1 N/A

Total Cost: 1850.00

,, .	Oditor Lip III (III)
N/A	Painted X Walk1?
	X Walk 1 Direction
N/A	X Walk 1 Width (in)
	X Walk 1 Slope (%)
	X Walk 1 X Slope (%)
N/A	Ramp inside XWalk1?
	Road Slope (%)
	Road X Slope (%)
N/A	Any Obstructions?
	Obstruction Type
No. 1	
1	
_	
A STATE OF	

Ramp Length (in)

Ramp Width (in)

Flare Slope LT (%)

Landing Length (in)

Landing Width (in)

Landing Slope (%)

Landing X Slope (%)

Landing Curb? (Y/N)

Shared Landing?

**Gutter Ponding?** 

Gutter Lip Ht (in)

Flare Traversable LT?

Flare Type LT





