


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 3390		Main Street: CRAYTON_DR		Cross Street: MANBEY_CT		Location: NE											
ADA ID: 69BCFC1DA9A2		Ramp Type: Directional1		Initial Pass/Fail: Pass		Overall Compliance: No		Severity Score: 0.25									
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance													
<div></div> <div>Street 1 NameMANBEY CT</div> <div>Stop Condition-Street 1None</div> <div>Street 2 NameN/A</div> <div>Stop Condition-Street 2N/A</div>				Possible Solutions:		Compliance		Description		Data		Compliance		Description		Data	
				Remove & Replace Entire Ramp.		N/A		Ramp Length (in)		52.0		Yes		Grade Break?		Yes	
Surveyor Notes:				N/A		Yes		Ramp Width (in)		48.0		No		Grade Break Slope (%)		6.6	
						Yes		Ramp Slope (%)		4.4		No		Grade Break XSlope (%)		4.1	
PROW/ADA:				R304.5.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para		No		Ramp XSlope (%)		2.1		N/A		Flare Type LT		N/A	
						N/A		Flare Slope LT (%)		N/A		N/A		Flare Slope RT (%)		N/A	
						N/A		Flare Traversable LT?		N/A		N/A		Flare Traversable RT?		N/A	
						Yes		Landing Length (in)		53.0		Yes		DWS Provided?		Yes	
						No		Landing Width (in)		46.0		Yes		DWS Contrast?		Yes	
						No		Landing Slope (%)		5.9		Yes		DWS Length (in)		24.0	
						Yes		Landing X Slope (%)		1.0		Yes		DWS Full Width?		Yes	
						N/A		Landing Curb? (Y/N)		No		Yes		DWS Offset LT (in)		0.0	
						N/A		Shared Landing?		No		Yes		DWS Offset RT (in)		45.0	
						Yes		Gutter Ponding?		No		Yes		Gutter Slope (%)		0.2	
						Yes		Gutter Lip Ht (in)		0.0		Yes		Gutter X Slope (%)		1.7	
						N/A		Painted X Walk1?		No				Road Slope (%)		0.8	
								X Walk 1 Direction		To S				Road X Slope (%)		1.7	
								X Walk 1 Width (in)		N/A				Clear Space?		Yes	
								X Walk 1 Slope (%)		0.8		N/A		Clear Space to XWalk (in)		N/A	
								X Walk 1 X Slope (%)		1.7		Yes		Storm Grate/Utility Hazard?		No	
						N/A		Ramp inside XWalk1?		N/A				Storm Grate/Utility Type			
						Yes		Any Obstructions?		No						N/A	
								Obstruction Type				Yes		Surface Condition? (G/P)		Good	
										N/A		N/A		Curb Slope (%)		5.8	
				Total Cost:		\$		1600.00									

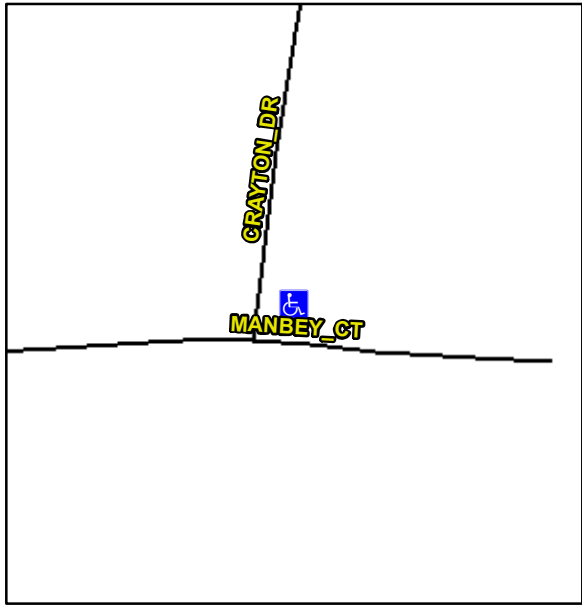