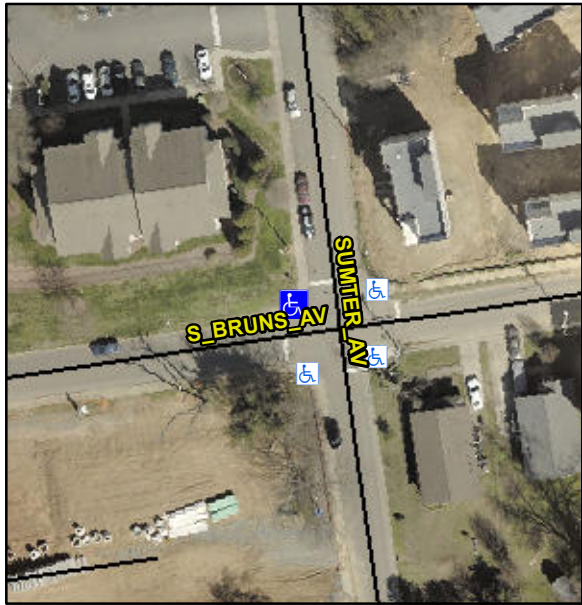


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 10737	Main Street: S_BRUNS_AV	Cross Street: SUMTER_AV	Location: NW
ADA ID: 6F2DFD1D3A53	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 46.25

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance					
	Possible Solutions:	Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.	N/A	Ramp Length (in)	59.0	No	Ramp Slope (%)	10.3
		No	Ramp Width (in)	40.0	No	Ramp XSlope (%)	9.0
		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
	N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A	
	N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A	
	N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A	
	N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A	
	N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A	
	N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A	
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A		
Surveyor Notes:	N/A	N/A	Shared Landing?	N/A			
		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
		N/A	Gutter Lip Ht (in)	0.5	N/A	Gutter X Slope (%)	N/A
	PROW/ADA:	N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
			X Walk 1 Direction	To S		X Walk 2 Direction	To E
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
			X Walk 1 Slope (%)	1.6		X Walk 2 Slope (%)	4.1
			X Walk 1 X Slope (%)	3.3		X Walk 2 X Slope (%)	6.2
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
			Road Slope (%)	5.0	N/A	Clear Space?	N/A
	Road X Slope (%)	2.0	N/A	Clear Space to XWalk (in)	N/A		
Total Cost:	\$ 3200.00	N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
			Obstruction Type			Storm Grate/Utility Type	
				N/A		N/A	
				Yes	Surface Condition? (G/P)	Good	

Total Cost: \$ 3200.00

