


Intersection ID: 10132	Main Street: CAMPUS_ST	Cross Street: MILL_RD	Location:	NW
ADA ID: 781DBC4AD185	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 22.5

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance							
	Possible Solutions:		Compliance			Description			Data	
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	31.0	No	Ramp Slope (%)	8.7		
			No	Ramp Width (in)	43.0	No	Ramp XSlope (%)	3.3		
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A		
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A		
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A		
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A		
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A		
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A		
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A		
Surveyor Notes:		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A			
PROW/ADA:		N/A	Shared Landing?	N/A	N/A	Gutter Slope (%)	N/A			
Not Found, R304.5.1, R304.2.2, R304.5.3		N/A	Gutter Ponding?	N/A	N/A	Gutter X Slope (%)	N/A			
		N/A	Gutter Lip Ht (in)	N/A	N/A	Painted X Walk2?	No			
		N/A	Painted X Walk1?	No	N/A	X Walk 2 Direction	To E			
		N/A	X Walk 1 Direction	To S	N/A	X Walk 2 Width (in)	N/A			
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Slope (%)	0.8			
		N/A	X Walk 1 Slope (%)	5.5	N/A	X Walk 2 X Slope (%)	2.8			
		N/A	X Walk 1 X Slope (%)	2.7	N/A	Ramp inside XWalk2?	N/A			
Street 1 Name		MILL RD	N/A	Ramp inside XWalk1?	N/A	N/A	Clear Space?	N/A		
Stop Condition-Street 2		StopSign	N/A	Road Slope (%)	3.1	N/A	Clear Space to XWalk (in)	N/A		
Street 2 Name		CAMPUS ST	N/A	Road X Slope (%)	2.0	N/A	Storm Grate/Utility Hazard?	N/A		
Stop Condition-Street 1		StopSign	N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Type	N/A		
Total Cost:		\$ 3200.00	N/A	Obstruction Type	N/A	Yes	Surface Condition? (G/P)	Good		

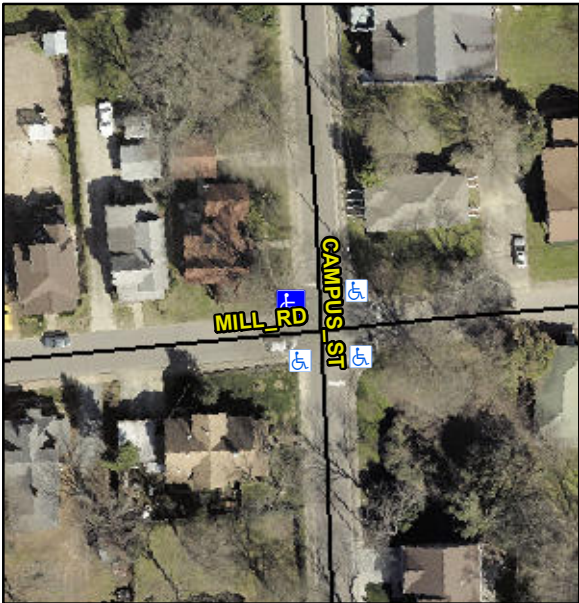