


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10077	Main Street: E_35TH_ST	Cross Street: N_DAVIDSON_ST	Location: SW
ADA ID: 7968CD0CFC2C	Ramp Type: BlendTrans2	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 7.5	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

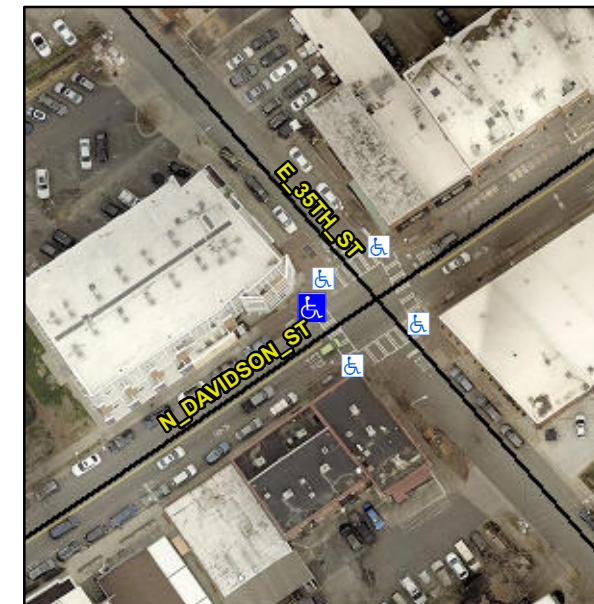

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Grind Gutter Lip.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.3, R302.7.2

Total Cost: \$ 3400.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	76.0	Yes	BlendTrans Slope (%)	4.5
Yes	Ramp Width (in)	48.0	Yes	BlendTrans XSlope (%)	0.7
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
No	Flare Slope LT (%)	N/A	No	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
N/A	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
N/A	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
N/A	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.0
N/A	Landing X Slope (%)	N/A	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.7
No	Gutter Lip Ht (in)	0.3	Yes	Gutter X Slope (%)	1.1
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SE		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	74.0		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.0		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.9		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.9		Clear Space?	Yes
	Road X Slope (%)	2.0	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			Yes	Curb Slope (%)	0.5

