


## **Access Compliance Report Public Rights-of-Way** (Curb Ramps)



Intersection ID: 29156 Main Street: BRANSCOMB DR **Cross Street: BRIDGEVILLE LN** Location: SW ADA ID: 79BB782D0626 Ramp Type: PerpDiag Initial Pass/Fail: Fail **Overall Compliance: No Severity Score:** 12.5

**Codes/Mitigation Info/Possible Solution** 

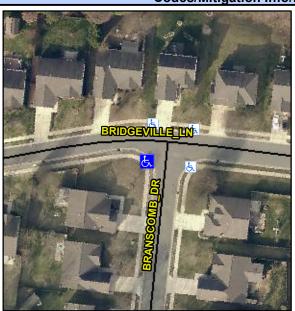

Street 1 Name Stop Condition-Street 2 Street 2 Name Stop Condition-Street 1 **BRANSCOMB DR** StopSign **BRIDGEVILLE LN** None

Possible Solutions: Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Surveyor Notes: N/A PROW/ADA: Not Found, R304.2.2

Total Cost: 3200.00

	0	Field Measurem					Data
		liance Description	Data			Description	Data
	N/A	Ramp Length (in)	49.0	No		Slope (%)	8.5
	Yes	Ramp Width (in)	73.0	Yes		XSlope (%)	0.1
	N/A	Flare Type LT	N/A	N/A		Type RT	N/A
	N/A	Flare Slope LT (%)	N/A	N/A		Slope RT (%)	N/A
	N/A	Flare Traversable LT?	N/A	N/A		Traversable RT?	N/A
	N/A	Landing Length (in)	N/A	N/A	DWS	Provided?	N/A
	N/A	Landing Width (in)	N/A	N/A	DWS	Contrast?	N/A
	N/A	Landing Slope (%)	N/A	N/A	DWS	Length (in)	N/A
	N/A	Landing X Slope (%)	N/A	N/A	DWS	Full Width?	N/A
	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS	Offset (in)	N/A
	N/A	Shared Landing?	N/A				
	N/A	Gutter Ponding?	N/A	N/A	Gutte	er Slope (%)	N/A
	N/A	Gutter Lip Ht (in)	N/A	N/A	Gutte	er X Slope (%)	N/A
	N/A	Painted X Walk1?	No	N/A	Paint	ed X Walk2?	No
		X Walk 1 Direction	To E		X Wa	lk 2 Direction	To N
	N/A	X Walk 1 Width (in)	N/A	N/A	X Wa	lk 2 Width (in)	N/A
		X Walk 1 Slope (%)	0.9		X Wa	lk 2 Slope (%)	0.5
		X Walk 1 X Slope (%)	1.4		X Wa	lk 2 X Slope (%)	2.3
	N/A	Ramp inside XWalk1?	N/A	N/A	Ram	o inside XWalk2?	N/A
		Road Slope (%)	0.5	N/A	Clear	Space?	N/A
		Road X Slope (%)	1.2	N/A	Clear	Space to XWalk (in)	N/A
	N/A	Any Obstructions?	N/A	N/A	Storn	n Grate/Utility Hazard?	N/A
		Obstruction Type			Storn	n Grate/Utility Type	
			N/A				N/A
				Yes	Surfa	ce Condition? (G/P)	Good
trepler.	Y		'	•		, ,	





