


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 51491	Main Street: N_TRYON_ST	Cross Street: INSTITUTE_CR	Location: S
ADA ID: 7AF8D238B9FC	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 15.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

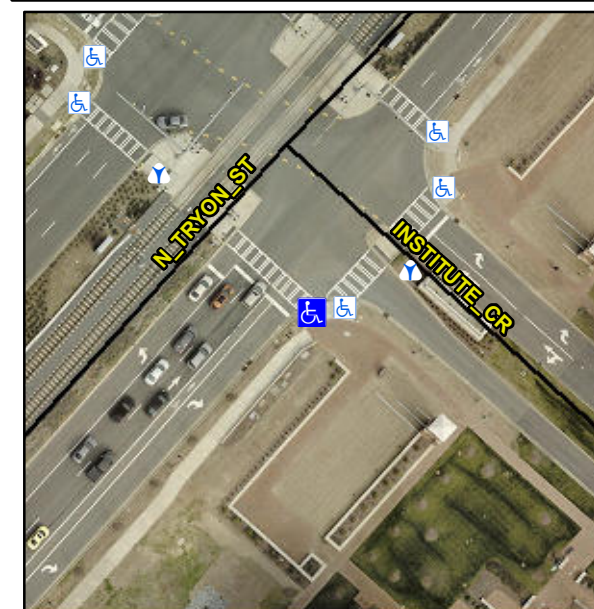

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.2.1, R304.5.3, R305.2, R302.7.2**

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	101.5	Yes	BlendTrans Slope (%)	5.0
Yes	Ramp Width (in)	48.0	Yes	BlendTrans XSlope (%)	2.7
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	1.8	N/A	Flare Slope RT (%)	6.9
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	89.0	Yes	DWS Provided?	Yes
No	Landing Width (in)	47.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.3	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	5.6	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	2.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.4
No	Gutter Lip Ht (in)	2.0	No	Gutter X Slope (%)	4.8
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NW		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.1		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	4.2		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	4.2		Clear Space?	Yes
	Road X Slope (%)	3.1	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	9.4

