

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

5.6

0.7

N/A

2.5

Nο

No

No

N/A

No

N/A

3.6

3.5

No

To N

N/A

0.7

2.7

N/A

Yes

N/A

No

N/A

Good

Intersection ID: 30319Main Street:HUNTER_FOREST_CTCross Street: HIDDEN_FOREST_DRLocation:SWADA ID: 7E9E964252ACRamp Type:PerpDiagInitial Pass/Fail:PassOverall Compliance:NoSeverity Score:25


Compliance Description

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

Compliance Description

Data

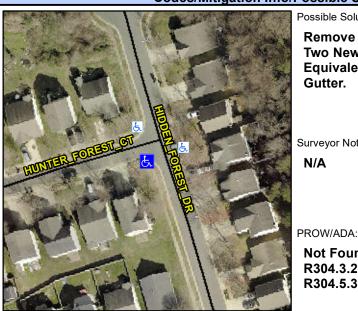

Street 1 Name
Stop Condition-Street 2
Street 2 Name
Stop Condition-Street 1

HIDDEN FOREST DR None HUNTER FOREST CT StopSign Possible Solutions:

Remove & Replace Curb Ramp With
Two New Directional Ramps or
Equivalent. Remove & Replace
Gutter.

Surveyor Notes:
N/A

Not Found, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305, R302.7.2, R304.5.3

Yes N/A Ramp Length (in) 49.0 Ramp Slope (%) Yes Ramp XSlope (%) Yes Ramp Width (in) 55.0 N/A N/A Flare Type LT Sloped Flare Type RT N/A 4.2 N/A Flare Slope RT (%) Flare Slope LT (%) N/A Flare Traversable LT? Nο N/A Flare Traversable RT? No 44.5 No DWS Provided? Landing Length (in) Yes Landing Width (in) 55.0 N/A **DWS Contrast?** N/A No Landing Slope (%) 5.3 DWS Length (in) N/A Yes Landing X Slope (%) 1.5 DWS Full Width? N/A Landing Curb? (Y/N) No N/A DWS Offset (in) N/A Shared Landing? No Gutter Ponding? Yes Gutter Slope (%) Yes No No Gutter Lip Ht (in) 1.0 No Gutter X Slope (%) N/A Painted X Walk1? No N/A Painted X Walk2? X Walk 1 Direction To E X Walk 2 Direction N/A N/A X Walk 1 Width (in) X Walk 2 Width (in) X Walk 1 Slope (%) 3.5 X Walk 2 Slope (%) X Walk 1 X Slope (%) 0.0 X Walk 2 X Slope (%) N/A N/A N/A Ramp inside XWalk2? Ramp inside XWalk1? Road Slope (%) 1.6 N/A Clear Space? N/A Road X Slope (%) 2.5 Clear Space to XWalk (in) No Yes Any Obstructions? Yes Storm Grate/Utility Hazard? **Obstruction Type** Storm Grate/Utility Type

N/A

Yes

Surface Condition? (G/P)





Total Cost:



3950.00