

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

6.9

2.0

N/A

N/A

No

Yes

Yes

24.0

Yes

0.5

3.4

0.3

N/A

N/A

N/A

N/A

N/A

N/A

Yes

N/A

No

N/A

Good

Main Street: N TRYON ST **Cross Street: ORCHARD TRACE LN** Intersection ID: 7131 Location: SE **Overall Compliance: No** 0 ADA ID: 801BC694C897 Ramp Type: Perp Initial Pass/Fail: Pass **Severity Score:**

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

Yes

Yes

Yes

N/A

N/A

Yes

Yes

Yes

Yes

Yes

Yes

Yes

N/A

N/A

N/A

N/A

N/A

Yes

Yes

Compliance Description

Ramp Slope (%)

Flare Type RT

Ramp XSlope (%)

Flare Slope RT (%)

DWS Provided?

DWS Contrast?

DWS Length (in)

DWS Full Width?

DWS Offset (in)

Gutter Slope (%)

Gutter X Slope (%)

Painted X Walk2?

X Walk 2 Direction

X Walk 2 Width (in)

X Walk 2 Slope (%)

X Walk 2 X Slope (%)

Ramp inside XWalk2?

Clear Space to XWalk (in)

Storm Grate/Utility Type

Surface Condition? (G/P)

Storm Grate/Utility Hazard?

Clear Space?

Flare Traversable RT?

Data

96.0

92.0

N/A

No

71.0

92.0

2.3

0.9

No

No

No

0.0

Yes

To W

105.0

2.8

1.2

Yes

N/A

N/A

No

N/A

X Walk 1 X Slope (%)

Ramp inside XWalk1?


Road X Slope (%)

Any Obstructions?

Obstruction Type

Flare Traversable LT?

Flare Type LCurbed_NoWalkSurface

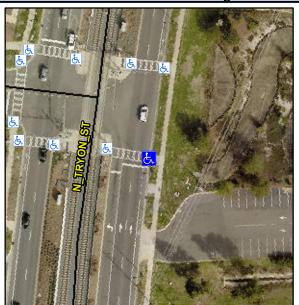

N TRYON ST Street 1 Name Stop Condition-Street 2 Signal N/A Street 2 Name Stop Condition-Street 1 N/A

Possible Solutions:	Compli	ance	Description
Remove & Replace Landing.	N/A	Ramp	Length (in)
·	Yes	Ramp	Width (in)
	Yes	Flare	Type L Curbed
	Yes	Flare	Slope LT (%)
	N/A	Flare	Traversable L1
	Yes	Landi	ng Length (in)
Surveyor Notes:	Yes	Landi	ng Width (in)
N/A	No	Landi	ng Slope (%)
4	Yes	Landi	ng X Slope (%
	N/A	Landi	ng Curb? (Y/N
	N/A	Share	ed Landing?
PROW/ADA:	Yes	Gutte	r Ponding?
R304.2.2-Perp, R304.3.2-Para	Yes	Gutte	r Lip Ht (in)
	N/A	Painte	ed X Walk1?
		X Wa	lk 1 Direction
	N/A	X Wa	lk 1 Width (in)
		X Wa	lk 1 Slope (%)
		X Wa	lk 1 X Slope (%
	Yes	Ramp	inside XWalk
		Road	Slope (%)

,	



Total Cost:



Yes

500.00