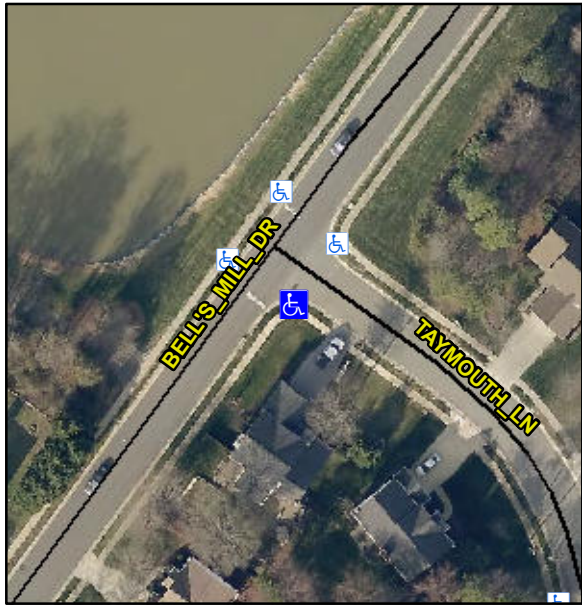


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 2868	Main Street: BELL'S_MILL_DR	Cross Street: TAYMOUTH_LN	Location: S
ADA ID: 851C941DEAA7	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 17.75

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance						
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	48.0	Yes	Ramp Slope (%)	6.0
			Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	3.7
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	3.9	N/A	Flare Slope RT (%)	11.6
			N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
			Yes	Landing Length (in)	50.0	No	DWS Provided?	No
			No	Landing Width (in)	22.0	N/A	DWS Contrast?	No
			Yes	Landing Slope (%)	0.5	N/A	DWS Length (in)	N/A
			No	Landing X Slope (%)	3.1	N/A	DWS Full Width?	No
Surveyor Notes:		N/A	N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
PROW/ADA:			N/A	Shared Landing?	No			
Not Found, R304.5.3, R304.2.1, R305, R302.7.2		Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.6	
		No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	1.8	
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No	
			X Walk 1 Direction	To NE		X Walk 2 Direction	To NW	
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	
			X Walk 1 Slope (%)	2.0		X Walk 2 Slope (%)	4.8	
			X Walk 1 X Slope (%)	3.1		X Walk 2 X Slope (%)	2.1	
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
			Road Slope (%)	0.4	N/A	Clear Space?	Yes	
			Road X Slope (%)	3.3	N/A	Clear Space to XWalk (in)	N/A	
		Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No	
			Obstruction Type			Storm Grate/Utility Type		
					N/A		N/A	
					Yes	Surface Condition? (G/P)	Good	
Total Cost:		\$	3200.00					

