

Access Compliance Report Public Rights-of-Way (Curb Ramps)




Intersection ID: 12194 Main Street: S_CEDAR_ST Cross Street: W_HILL_ST Location: S

ADA ID: 8B7CB107D42D Ramp Type: PerpDiag Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 2.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

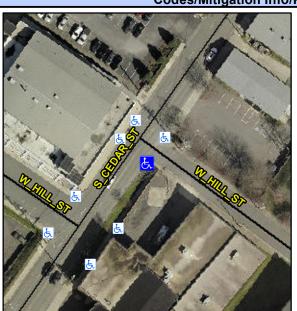

Street 1 Name
Stop Condition-Street 2
Street 2 Name
Stop Condition-Street 1

W HILL ST StopSign S CEDAR ST

None

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3, R304.2.2-Perp, R304.3.2-Para, R305.1.4, R305.2

Total Cost: \$ 3950.00

Compliance Description Da		Data	Comp	oliance Description	Data
N/A	Ramp Length (in)	62.0	Yes	Ramp Slope (%)	5.9
Yes	Ramp Width (in)	60.0	No	Ramp XSlope (%)	3.2
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	8.5	Yes	Flare Slope RT (%)	0.7
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	60.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	60.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	5.0	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	3.3	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	4.5
N/A	Shared Landing?	Yes			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.7
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.5
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.6		X Walk 2 Slope (%)	5.2
	X Walk 1 X Slope (%)	2.1		X Walk 2 X Slope (%)	1.2
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.9	N/A	Clear Space?	Yes
	Road X Slope (%)	1.0	N/A	Clear Space to XWalk (in)	N/A

No Yes

N/A

Storm Grate/Utility Hazard?

Storm Grate/Utility Type

Surface Condition? (G/P)

No

N/A

Good







Yes

Any Obstructions?

Obstruction Type