

## Access Compliance Report Public Rights-of-Way (Curb Ramps)




Intersection ID: 18131 Main Street: E\_WOODLAWN\_RD Cross Street: DARWIN\_CR Location: SE

ADA ID: 8E60B88A3A8C Ramp Type: Para Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 1.25

Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance

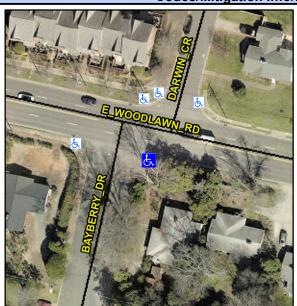

Street 1 Name

Stop Condition-Street 1

StopSign

Street 2 Name

N/A

Stop Condition-Street 2

N/A

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3

Total Cost: \$ 1600.00

Compliance         Description         Data         Compliance         Description           N/A         Ramp Length LT (in)         50.0         N/A         Ramp Length RT (in)	Data 1) 61.0
N/A Ramp Length LT (in) 50.0 N/A Ramp Length RT (in	61.0
Tamp Longar Li (iii)	
Yes Ramp Width LT (in) 84.0 Yes Ramp Width RT (in)	83.0
Yes Ramp Slope LT (%) 6.1 Yes Ramp Slope RT (%)	6.2
No Ramp XSlope LT (%) 4.1 No Ramp XSlope RT (%	<b>6</b> ) <b>2.3</b>
N/A Landing Length (in) N/A N/A DWS Provided?	N/A
N/A Landing Width (in) N/A N/A DWS Contrast?	N/A
N/A Landing Slope (%) N/A N/A DWS Length (in)	N/A
N/A Landing X Slope (%) N/A N/A DWS Full Width?	N/A
N/A Landing Curb? (Y/N) N/A N/A DWS Offset (in)	N/A
N/A Shared Landing? N/A	
N/A Gutter Ponding? N/A N/A Gutter Slope (%)	N/A
N/A Gutter Lip Ht (in) 1.0 N/A Gutter X Slope (%)	N/A
N/A Painted X Walk1? No N/A Painted X Walk2?	N/A
X Walk 1 Direction To W X Walk 2 Direction	N/A
N/A X Walk 1 Width (in) N/A N/A X Walk 2 Width (in)	N/A
X Walk 1 Slope (%) <b>2.1</b> X Walk 2 Slope (%)	N/A
X Walk 1 X Slope (%) 3.7 X Walk 2 X Slope (%)	6) N/A
N/A Ramp inside XWalk1? N/A N/A Ramp inside XWalk1	2? <b>N/A</b>
Road Slope (%) N/A N/A Clear Space?	N/A
Road X Slope (%) N/A N/A Clear Space to XWa	ılk (in) N/A
N/A Any Obstructions? N/A N/A Storm Grate/Utility F	lazard? N/A
Obstruction Type Storm Grate/Utility T	уре
N/A	N/A
Yes Surface Condition?	(G/P) Good
N/A Curb Slope (%)	7.8





