

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 46144	Main Street: EASTFIELD_VILLAGE_LN	Cross Street: ROCKY_FORD_CLUB_RD	Location: E
ADA ID: 8FBE9EC9FC34	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 15

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

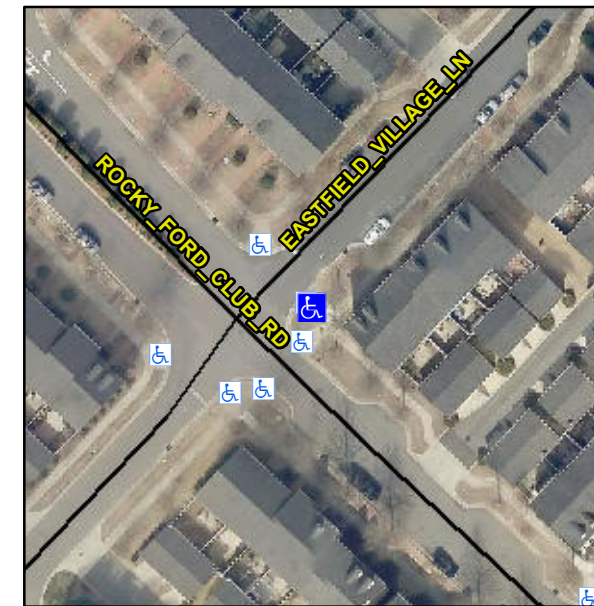

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Grind Gutter Lip.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.2-Perp, R304.3.2-Para, R305.2, R302.7.2

Total Cost: \$ 3400.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	194.0	Yes	BlendTrans Slope (%)	2.7
Yes	Ramp Width (in)	48.0	Yes	BlendTrans XSlope (%)	0.1
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	10.2	N/A	Flare Slope RT (%)	8.4
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	59.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.7	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.8	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	3.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.6
No	Gutter Lip Ht (in)	1.0	Yes	Gutter X Slope (%)	1.2
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NW		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.4		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.9		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.9		Clear Space?	Yes
	Road X Slope (%)	0.4	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	N/A

Street 1 Name	EASTFIELD VILLAGE LN
Stop Condition-Street 1	StopSign
Street 2 Name	N/A
Stop Condition-Street 2	N/A

