


| | | | | |
|------------------------|----------------------------------|--------------------------|------------------------|-----------------------|
| Intersection ID: 13413 | Main Street: OLD_STEELE_CREEK_RD | Cross Street: SEYMOUR_DR | Location: | NW |
| ADA ID: 9222F5A364DC | Ramp Type: ParaDiag | Initial Pass/Fail: Fail | Overall Compliance: No | Severity Score: 13.75 |

| Codes/Mitigation Info/Possible Solution | Field Measurements/Component Compliance |
|---|---|
|---|---|

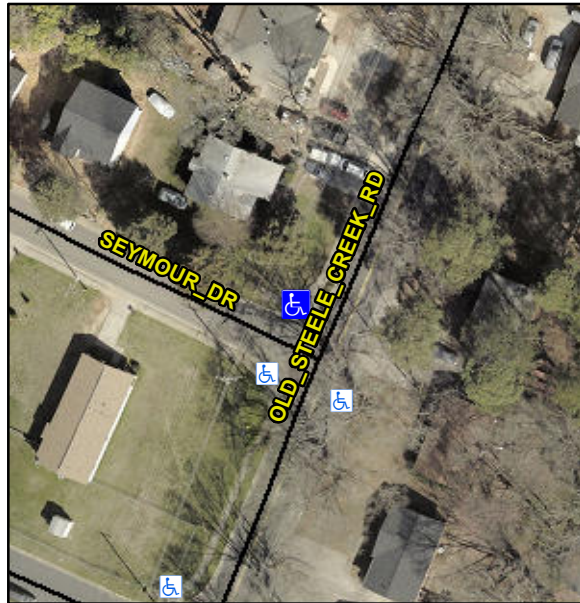

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

LT RP < 5%

PROW/ADA:

R304.3.2, R304.5.3

| Compliance | Description | Data | Compliance | Description | Data |
|------------|----------------------|-------|------------|-----------------------------|-------|
| N/A | Ramp Length LT (in) | 66.0 | N/A | Ramp Length RT (in) | 57.0 |
| Yes | Ramp Width LT (in) | 104.0 | Yes | Ramp Width RT (in) | 108.0 |
| Yes | Ramp Slope LT (%) | 2.8 | No | Ramp Slope RT (%) | 8.7 |
| Yes | Ramp XSlope LT (%) | 1.4 | No | Ramp XSlope RT (%) | 2.3 |
| N/A | Landing Length (in) | N/A | N/A | DWS Provided? | N/A |
| N/A | Landing Width (in) | N/A | N/A | DWS Contrast? | N/A |
| N/A | Landing Slope (%) | N/A | N/A | DWS Length (in) | N/A |
| N/A | Landing X Slope (%) | N/A | N/A | DWS Full Width? | N/A |
| N/A | Landing Curb? (Y/N) | N/A | N/A | DWS Offset (in) | N/A |
| N/A | Shared Landing? | N/A | | | |
| N/A | Gutter Ponding? | N/A | N/A | Gutter Slope (%) | N/A |
| N/A | Gutter Lip Ht (in) | N/A | N/A | Gutter X Slope (%) | N/A |
| N/A | Painted X Walk1? | No | N/A | Painted X Walk2? | No |
| | X Walk 1 Direction | To S | | X Walk 2 Direction | To E |
| N/A | X Walk 1 Width (in) | N/A | N/A | X Walk 2 Width (in) | N/A |
| | X Walk 1 Slope (%) | 1.1 | | X Walk 2 Slope (%) | 3.4 |
| | X Walk 1 X Slope (%) | 1.2 | | X Walk 2 X Slope (%) | 1.4 |
| N/A | Ramp inside XWalk1? | N/A | N/A | Ramp inside XWalk2? | N/A |
| | Road Slope (%) | 4.1 | N/A | Clear Space? | N/A |
| | Road X Slope (%) | 1.3 | N/A | Clear Space to XWalk (in) | N/A |
| N/A | Any Obstructions? | N/A | N/A | Storm Grate/Utility Hazard? | N/A |
| | Obstruction Type | | | Storm Grate/Utility Type | |
| | | N/A | | | N/A |
| | | | Yes | Surface Condition? (G/P) | Good |
| | | | N/A | Curb Slope (%) | 15.0 |

Total Cost: \$ 3200.00

