


Intersection ID: 16452	Main Street: STANFORD_PL	Cross Street: WELLESLEY_AV	Location:	E
ADA ID: 9CE7D0A13317	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 15.25

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

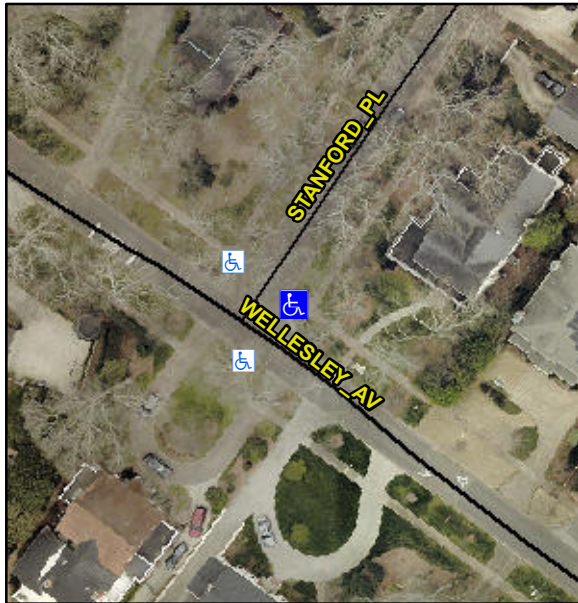

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3, R305, R304.5.4

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	61.5	Yes	Ramp Slope (%)	7.0
Yes	Ramp Width (in)	58.0	No	Ramp XSlope (%)	3.4
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	12.0	N/A	Flare Slope RT (%)	4.7
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	52.5	No	DWS Provided?	No
Yes	Landing Width (in)	58.0	N/A	DWS Contrast?	No
Yes	Landing Slope (%)	1.8	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	2.8	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	5.2
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.6
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NW		X Walk 2 Direction	To SW
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.6		X Walk 2 Slope (%)	0.9
	X Walk 1 X Slope (%)	0.5		X Walk 2 X Slope (%)	1.6
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.8	N/A	Clear Space?	Yes
	Road X Slope (%)	1.9	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 3950.00

Street 1 Name	STANFORD PL
Stop Condition-Street 2	StopSign
Street 2 Name	WELLESLEY AV
Stop Condition-Street 1	None

