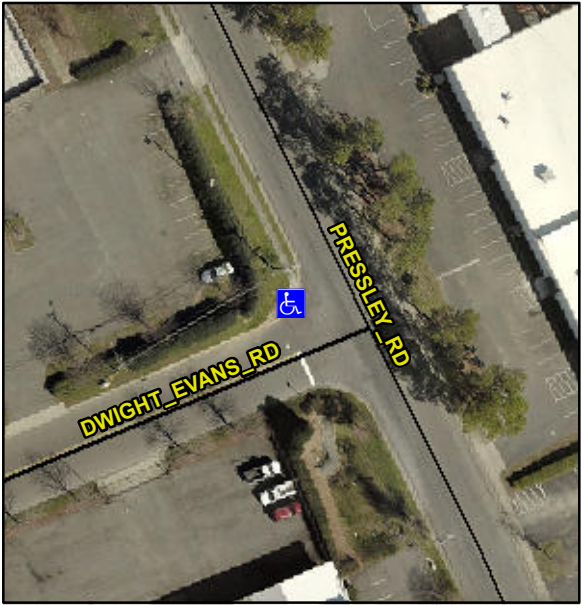


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 16192	Main Street: DWIGHT_EVANS_RD	Cross Street: PRESSLEY_RD	Location: NW
ADA ID: 9CFACAA06E9E	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 21.25

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance			
 <p>Street 1 Name DWIGHT EVANS RD</p> <p>Stop Condition-Street 2 StopSign</p> <p>Street 2 Name PRESSLEY RD</p> <p>Stop Condition-Street 1 None</p>	Possible Solutions:	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.			
	Surveyor Notes:	N/A			
	PROW/ADA:	Not Found, R304.5.1, R304.2.2			
			Compliance	Description	Data
			No	Ramp Length (in)	46.0
			No	Ramp Width (in)	38.0
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
			N/A	Landing Curb? (Y/N)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			No	Painted X Walk1?	No
			To S	X Walk 1 Direction	To E
			N/A	X Walk 1 Width (in)	N/A
			6.2	X Walk 1 Slope (%)	2.7
			0.7	X Walk 1 X Slope (%)	4.2
			N/A	Ramp inside XWalk1?	N/A
			1.4	Road Slope (%)	N/A
			8.5	Road X Slope (%)	N/A
			N/A	Any Obstructions?	N/A
			N/A	Obstruction Type	N/A
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good
Total Cost:		\$ 3200.00			

