

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

6.9

0.3

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

Intersection ID: 2516 Main Street: ROCKY FORD CLUB RD Cross Street: EASTFIELD RD Location: W **Overall Compliance: No Severity Score: ADA ID: 9EAD879C271A** Ramp Type: Perp Initial Pass/Fail: Fail 8.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

Yes

Yes

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

Compliance Description

Ramp Slope (%)

Flare Type RT

Ramp XSlope (%)

Flare Slope RT (%)

DWS Provided?

DWS Contrast?

DWS Length (in)

DWS Full Width?

DWS Offset (in)

Flare Traversable RT?

Data

96.0

47.0

N/A

N/A

N/A

N/A

N/A

N/A


N/A

N/A



EASTFIELD RD Street 1 Name Stop Condition-Street 2 None N/A Street 2 Name Stop Condition-Street 1 N/A Possible Solutions: Remove & Replace Entire Ramp. Surveyor Notes: N/A PROW/ADA: R304.5.1

N/A N/A N/A Total Cost: 1850.00

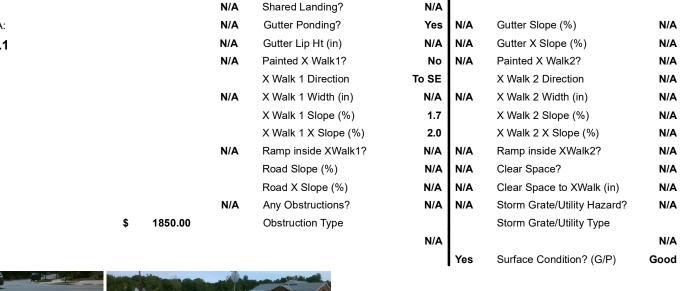

Compliance Description

Ramp Length (in)

Ramp Width (in)

Flare Slope LT (%)

Landing Length (in)

Landing Width (in)

Landing Slope (%)

Landing X Slope (%)

Landing Curb? (Y/N)

Flare Traversable LT?

Flare Type LT

N/A

No

N/A

N/A

N/A

N/A

N/A

N/A



