


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: N/A	Main Street: MARTIN_LUTHER_KING_JR_BV	Cross Street: N/A	Location: W
ADA ID: 9EF9449E20F2	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 0.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

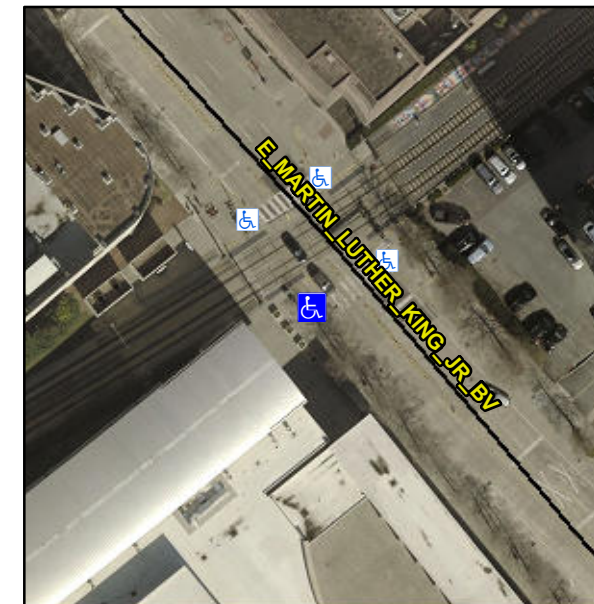

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3

Total Cost:

\$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	70.0	Yes	BlendTrans Slope (%)	2.5
Yes	Ramp Width (in)	48.0	No	BlendTrans XSlope (%)	2.2
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
Yes	Flare Slope LT (%)	5.2	Yes	Flare Slope RT (%)	7.4
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	48.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.1	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	2.7	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.0
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.8
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To E		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	135.0		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.1		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	2.2		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.2		Clear Space?	Yes
	Road X Slope (%)	0.1	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	0.3

