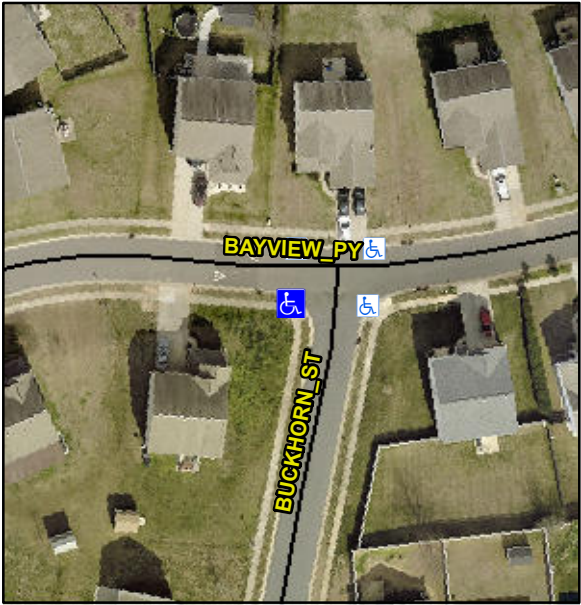


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 44452	Main Street: BAYVIEW_PY	Cross Street: BUCKHORN_ST	Location: SW
ADA ID: A131570B4B44	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 36.25

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance					
	Possible Solutions:						
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.	N/A	Ramp Length (in)	49.5	Yes	Ramp Slope (%)	7.7
		No	Ramp Width (in)	30.0	No	Ramp XSlope (%)	2.7
		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
		N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
		N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
		N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
		N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
		N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
		N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>R304.5.1, R304.5.3</p>		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
		N/A	Shared Landing?	N/A			
		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
			X Walk 1 Direction	To E		X Walk 2 Direction	To N
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
			X Walk 1 Slope (%)	0.5		X Walk 2 Slope (%)	3.2
			X Walk 1 X Slope (%)	0.7		X Walk 2 X Slope (%)	0.0
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
<p>Street 1 Name</p> <p>Stop Condition-Street 2</p> <p>Street 2 Name</p> <p>Stop Condition-Street 1</p>	BUCKHORN ST <p>StopSign</p> <p>BAYVIEW PY</p> <p>None</p>						
			Road Slope (%)	1.5	N/A	Clear Space?	N/A
			Road X Slope (%)	0.0	N/A	Clear Space to XWalk (in)	N/A
		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
			Obstruction Type			Storm Grate/Utility Type	
					N/A		N/A
					Yes	Surface Condition? (G/P)	Good
Total Cost:		\$	3200.00				

