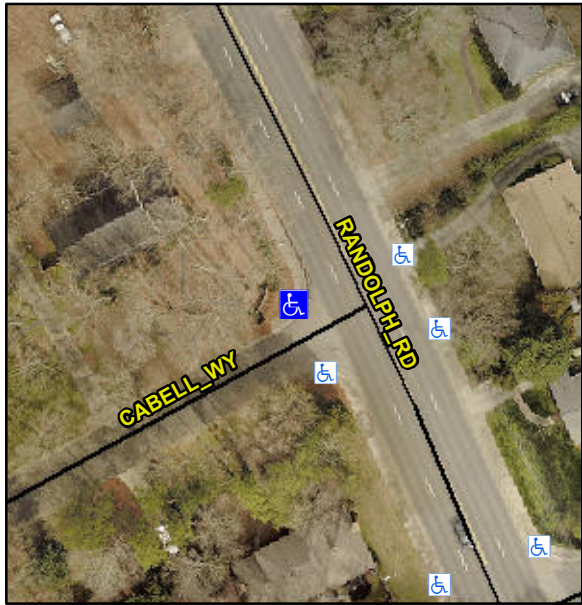


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 18691	Main Street: CABELL_WY	Cross Street: RANDOLPH_RD	Location: NW
ADA ID: A3E525B17368	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 21.25	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
 <div>Street 1 Name<div>CABELL WY</div></div> <div>Stop Condition-Street 2<div>StopSign</div></div> <div>Street 2 Name<div>RANDOLPH RD</div></div> <div>Stop Condition-Street 1<div>None</div></div>	Possible Solutions: Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		Compliance	Description	Data	Compliance	Description	Data
			N/A	Ramp Length (in)	73.0	No	Ramp Slope (%)	9.1
			No	Ramp Width (in)	42.5	Yes	Ramp XSlope (%)	0.7
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
Surveyor Notes: N/A		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	
		N/A	Shared Landing?	N/A				
PROW/ADA: Not Found, R304.5.1, R304.2.2		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A	
		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A	
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No	
			X Walk 1 Direction	To S		X Walk 2 Direction	To E	
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	
			X Walk 1 Slope (%)	1.7		X Walk 2 Slope (%)	2.4	
			X Walk 1 X Slope (%)	1.3		X Walk 2 X Slope (%)	2.2	
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
			Road Slope (%)	1.9	N/A	Clear Space?	N/A	
			Road X Slope (%)	0.8	N/A	Clear Space to XWalk (in)	N/A	
		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
			Obstruction Type			Storm Grate/Utility Type		
				N/A			N/A	
					Yes	Surface Condition? (G/P)	Good	
Total Cost:		\$ 3200.00						

