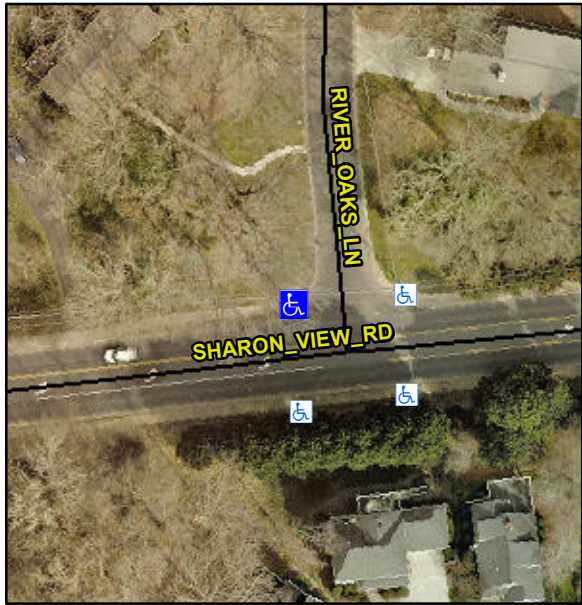


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

|                        |                            |                              |                        |
|------------------------|----------------------------|------------------------------|------------------------|
| Intersection ID: 22484 | Main Street: RIVER_OAKS_LN | Cross Street: SHARON_VIEW_RD | Location: NW           |
| ADA ID: A906B344D43B   | Ramp Type: PerpDiag        | Initial Pass/Fail: Fail      | Overall Compliance: No |
|                        |                            |                              | Severity Score: 18.75  |

| Codes/Mitigation Info/Possible Solution  |   |                               | Field Measurements/Component Compliance |                       |       |            |                             |      |
|--|---|-------------------------------|---|-----------------------|-------|------------|-----------------------------|------|
|  | Possible Solutions:   |                               | Compliance                              | Description           | Data  | Compliance | Description                 | Data |
|  | <b>Remove &amp; Replace Curb Ramp With Two New Directional Ramps or Equivalent.</b> |                               | N/A                                     | Ramp Length (in)      | 108.0 | Yes        | Ramp Slope (%)              | 5.8  |
|  |   |                               | No                                      | Ramp Width (in)       | 34.0  | No         | Ramp XSlope (%)             | 4.1  |
|  |   |                               | N/A                                     | Flare Type LT         | N/A   | N/A        | Flare Type RT               | N/A  |
|  |   |                               | N/A                                     | Flare Slope LT (%)    | N/A   | N/A        | Flare Slope RT (%)          | N/A  |
|  |   |                               | N/A                                     | Flare Traversable LT? | N/A   | N/A        | Flare Traversable RT?       | N/A  |
|  |   |                               | N/A                                     | Landing Length (in)   | N/A   | N/A        | DWS Provided?               | N/A  |
|  |   |                               | N/A                                     | Landing Width (in)    | N/A   | N/A        | DWS Contrast?               | N/A  |
|  |   |                               | N/A                                     | Landing Slope (%)     | N/A   | N/A        | DWS Length (in)             | N/A  |
|  |   |                               | N/A                                     | Landing X Slope (%)   | N/A   | N/A        | DWS Full Width?             | N/A  |
| Surveyor Notes:  |   | N/A                           | N/A                                     | Landing Curb? (Y/N)   | N/A   | N/A        | DWS Offset (in)             | N/A  |
| PROW/ADA:  |   | Not Found, R304.5.1, R304.5.3 | N/A                                     | Shared Landing?       | N/A   |            |                             |      |
|  |   |                               | N/A                                     | Gutter Ponding?       | N/A   | N/A        | Gutter Slope (%)            | N/A  |
|  |   |                               | N/A                                     | Gutter Lip Ht (in)    | N/A   | N/A        | Gutter X Slope (%)          | N/A  |
|  |   |                               | N/A                                     | Painted X Walk1?      | No    | N/A        | Painted X Walk2?            | No   |
|  |   |                               |   | X Walk 1 Direction    | To S  |            | X Walk 2 Direction          | To E |
|  |   |                               | N/A                                     | X Walk 1 Width (in)   | N/A   | N/A        | X Walk 2 Width (in)         | N/A  |
|  |   |                               |   | X Walk 1 Slope (%)    | 2.3   |            | X Walk 2 Slope (%)          | 4.7  |
|  |   |                               |   | X Walk 1 X Slope (%)  | 3.5   |            | X Walk 2 X Slope (%)        | 0.3  |
|  |   |                               | N/A                                     | Ramp inside XWalk1?   | N/A   | N/A        | Ramp inside XWalk2?         | N/A  |
|  |   |                               |   | Road Slope (%)        | 2.3   | N/A        | Clear Space?                | N/A  |
|  |   |                               |   | Road X Slope (%)      | 3.0   | N/A        | Clear Space to XWalk (in)   | N/A  |
|  |   |                               | N/A                                     | Any Obstructions?     | N/A   | N/A        | Storm Grate/Utility Hazard? | N/A  |
|  |   |                               |   | Obstruction Type      |       |            | Storm Grate/Utility Type    |      |
|  |   |                               |   |                       | N/A   |            |                             | N/A  |
|  |   |                               |   |                       |       | Yes        | Surface Condition? (G/P)    | Good |
| Street 1 Name  |   | SHARON VIEW RD                |   |                       |       |            |                             |      |
| Stop Condition-Street 2  |   | None                          |   |                       |       |            |                             |      |
| Street 2 Name  |   | RIVER OAKS LN                 |   |                       |       |            |                             |      |
| Stop Condition-Street 1  |   | StopSign                      |   |                       |       |            |                             |      |
| Total Cost:  |   | \$ 3200.00                    |   |                       |       |            |                             |      |

Total Cost: \$ 3200.00

