

## Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 44933 Main Street: ACORN\_FOREST\_LN Cross Street: BRUMIT\_LN Location: E

ADA ID: ADDB95A0219F Ramp Type: Perp Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 37.5

Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance



| 0.00                  |                 |
|-----------------------|-----------------|
| Street 1 Name         | ACORN FOREST LN |
| Stop Condition-Street | None None       |
| Street 2 Name         | N/A             |
| Stop Condition-Street | 1 N/A           |

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:


N/A

PROW/ADA:

Not Found, R304.2.2, R304.5.3

| Comp | liance Description    | Data  | Comp | liance Description          | Data |
|------|-----------------------|-------|------|-----------------------------|------|
| N/A  | Ramp Length (in)      | 48.0  | No   | Ramp Slope (%)              | 20.0 |
| Yes  | Ramp Width (in)       | 50.0  | No   | Ramp XSlope (%)             | 5.9  |
| N/A  | Flare Type LT         | N/A   | N/A  | Flare Type RT               | N/A  |
| N/A  | Flare Slope LT (%)    | N/A   | N/A  | Flare Slope RT (%)          | N/A  |
| N/A  | Flare Traversable LT? | N/A   | N/A  | Flare Traversable RT?       | N/A  |
| N/A  | Landing Length (in)   | N/A   | N/A  | DWS Provided?               | N/A  |
| N/A  | Landing Width (in)    | N/A   | N/A  | DWS Contrast?               | N/A  |
| N/A  | Landing Slope (%)     | N/A   | N/A  | DWS Length (in)             | N/A  |
| N/A  | Landing X Slope (%)   | N/A   | N/A  | DWS Full Width?             | N/A  |
| N/A  | Landing Curb? (Y/N)   | N/A   | N/A  | DWS Offset (in)             | N/A  |
| N/A  | Shared Landing?       | N/A   |      |                             |      |
| N/A  | Gutter Ponding?       | N/A   | N/A  | Gutter Slope (%)            | N/A  |
| N/A  | Gutter Lip Ht (in)    | N/A   | N/A  | Gutter X Slope (%)          | N/A  |
| N/A  | Painted X Walk1?      | No    | N/A  | Painted X Walk2?            | N/A  |
|      | X Walk 1 Direction    | To NW |      | X Walk 2 Direction          | N/A  |
| N/A  | X Walk 1 Width (in)   | N/A   | N/A  | X Walk 2 Width (in)         | N/A  |
|      | X Walk 1 Slope (%)    | 2.9   |      | X Walk 2 Slope (%)          | N/A  |
|      | X Walk 1 X Slope (%)  | 5.7   |      | X Walk 2 X Slope (%)        | N/A  |
| N/A  | Ramp inside XWalk1?   | N/A   | N/A  | Ramp inside XWalk2?         | N/A  |
|      | Road Slope (%)        | N/A   | N/A  | Clear Space?                | N/A  |
|      | Road X Slope (%)      | N/A   | N/A  | Clear Space to XWalk (in)   | N/A  |
| N/A  | Any Obstructions?     | N/A   | N/A  | Storm Grate/Utility Hazard? | N/A  |
|      | Obstruction Type      |       |      | Storm Grate/Utility Type    |      |
|      |                       | N/A   |      |                             | N/A  |
|      |                       |       | Yes  | Surface Condition? (G/P)    | Good |



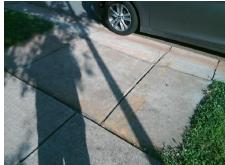

Total Cost:



1850.00