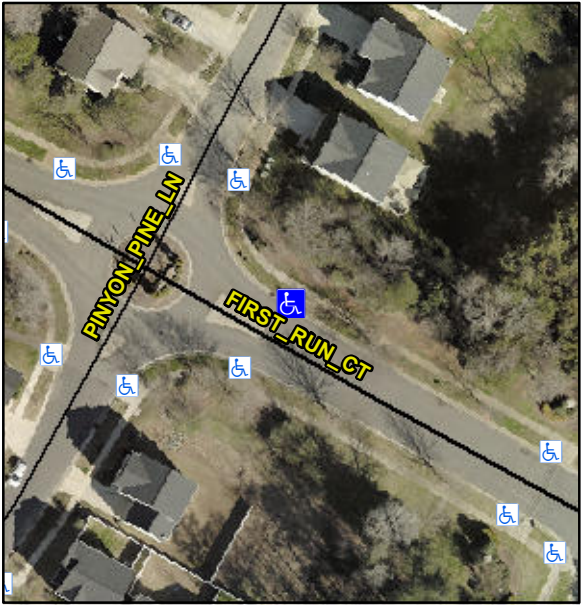


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

| | | | |
|------------------------|---------------------------|------------------------------|------------------------|
| Intersection ID: 31765 | Main Street: FIRST_RUN_CT | Cross Street: PINYON_PINE_LN | Location: E |
| ADA ID: B2766EB72B40 | Ramp Type: Perp | Initial Pass/Fail: Fail | Overall Compliance: No |
| | | | Severity Score: 13.75 |

| Codes/Mitigation Info/Possible Solution | | | Field Measurements/Component Compliance | | |
|--|--|--|---|-----------------------------|-------------|
|  | Possible Solutions: | | Compliance | Description | Data |
| | Remove & Replace Entire Ramp. | | No | Ramp Length (in) | 86.0 |
| | | | Yes | Ramp Width (in) | 48.0 |
| | | | N/A | Flare Type LT | N/A |
| | | | N/A | Flare Slope LT (%) | N/A |
| | | | N/A | Flare Traversable LT? | N/A |
| | | | N/A | Landing Length (in) | N/A |
| | | | N/A | Landing Width (in) | N/A |
| | | | N/A | Landing Slope (%) | N/A |
| | | | N/A | Landing X Slope (%) | N/A |
| <p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>R304.2.2, R304.5.3</p> | | | N/A | Flare Type RT | N/A |
| | | | N/A | Flare Slope RT (%) | N/A |
| | | | N/A | Flare Traversable RT? | N/A |
| | | | N/A | DWS Provided? | N/A |
| | | | N/A | DWS Contrast? | N/A |
| | | | N/A | DWS Length (in) | N/A |
| | | | N/A | DWS Full Width? | N/A |
| | | | N/A | DWS Offset (in) | N/A |
| | | | N/A | Gutter Ponding? | N/A |
| | | | N/A | Gutter Lip Ht (in) | 0.5 |
| <p>Total Cost:</p> <p>\$ 1850.00</p> | | | No | Painted X Walk2? | N/A |
| | | | | X Walk 2 Direction | N/A |
| | | | N/A | X Walk 2 Width (in) | N/A |
| | | | 0.8 | X Walk 2 Slope (%) | N/A |
| | | | 4.9 | X Walk 2 X Slope (%) | N/A |
| | | | N/A | Ramp inside XWalk2? | N/A |
| | | | N/A | Clear Space? | N/A |
| | | | N/A | Clear Space to XWalk (in) | N/A |
| | | | N/A | Storm Grate/Utility Hazard? | N/A |
| | | | N/A | Storm Grate/Utility Type | N/A |
| | | | N/A | Surface Condition? (G/P) | Good |

