

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10029243	Main Street: JOHNSTON_RD	Cross Street: N/A	Location: SW
ADA ID: B72FD2044CF6	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0.25	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

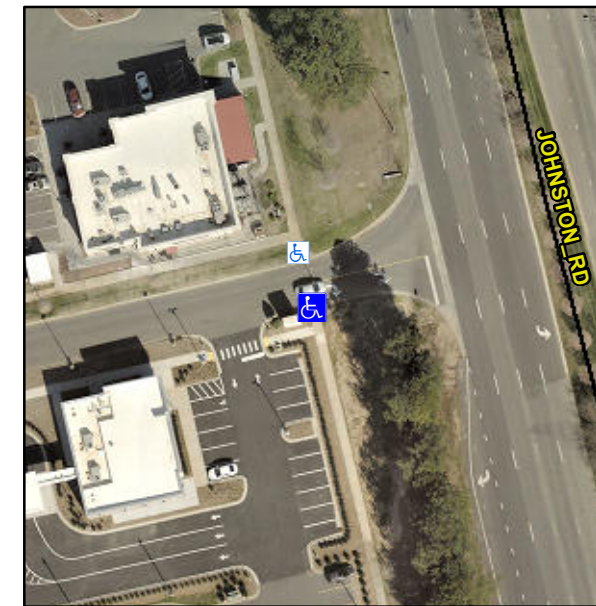

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3, R304.2.1

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	57.0	Yes	BlendTrans Slope (%)	2.7
Yes	Ramp Width (in)	48.0	No	BlendTrans XSlope (%)	2.9
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	0.1	N/A	Flare Slope RT (%)	6.8
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
No	Landing Length (in)	45.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.4	Yes	DWS Length (in)	25.5
Yes	Landing X Slope (%)	0.7	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.9
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.9
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To N		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.9		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	2.7		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.7		Clear Space?	Yes
	Road X Slope (%)	0.9	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	19.0

Total Cost: \$ 3950.00

