

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

N/A

0.0

0.0

N/A

0.0

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

5.1

12.2

N/A

N/A

N/A

N/A

Good

15.5

Intersection ID: 11016 Main Street: AMBASSADOR ST **Cross Street: TUCKASEEGEE RD** Location: Initial Pass/Fail: Fail **Overall Compliance: No** Severity Score: 33.75 ADA ID: BAA4845CB6C4 Ramp Type: Directional1

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

Yes

N/A N/A

Clear Space to XWalk (in)

Storm Grate/Utility Type

Surface Condition? (G/P)

Curb Slope (%)

Storm Grate/Utility Hazard?

Flare Traversable RT?

Grade Break Slope (%)


Grade Break XSlope (%)



Street 1 Name	AMBASSADOR ST
Stop Condition-Street 1	StopSign
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Possible Solution	Field Measurements/Component Compilar					
Possible Solutions:	Comp	Compliance Description		Compliance Description		
Remove & Replace Entire Ramp.	N/A	Ramp Length (in)	73.0	N/A	Grade Break?	
•	No	Ramp Width (in)	47.5	N/A	Grade Break Slope (
	No	Ramp Slope (%)	15.6	N/A	Grade Break XSlope	
	Yes	Ramp XSlope (%)	0.6			
	N/A	Flare Type LT	N/A	N/A	Flare Type RT	
	N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	
Surveyor Notes:	N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable R1	
N/A	N/A	Landing Length (in)	0.0	N/A	DWS Provided?	
	N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	
	N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	
	N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	
PROW/ADA:	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	
R304.5.1, R304.2.2	N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	
	N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	
	N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	
	N/A	Painted X Walk1?	No		Road Slope (%)	
		X Walk 1 Direction	To N		Road X Slope (%)	
		X Walk 1 Width (in)	N/A		Clear Space?	
		X Walk 1 Slope (%)	5.1	N/A	Clear Space to XWa	
		X Walk 1 X Slope (%)	12.2	N/A	Storm Grate/Utility H	
	N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility T	
	N/A	Any Obstructions?	N/A			



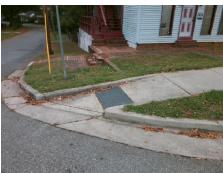

Total Cost:



1600.00

Obstruction Type