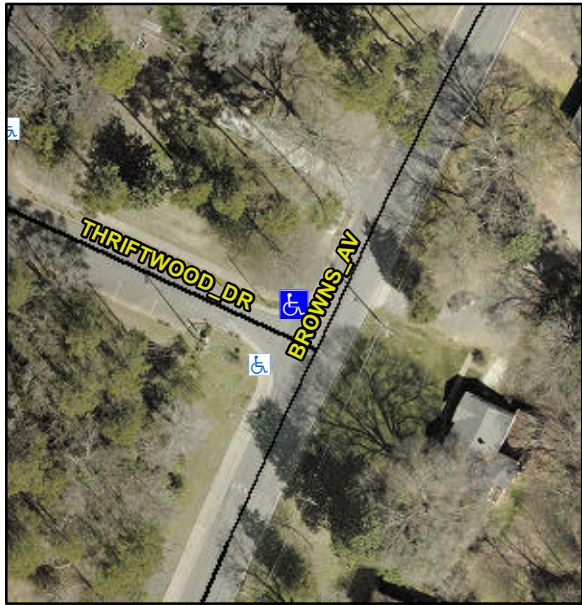


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 9637	Main Street: BROWNS_AV	Cross Street: THRIFTWOOD_DR	Location:	N
ADA ID: BB0A9384A998	Ramp Type: Combination1	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 13.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length LT (in)	38.0	N/A	Ramp Length RT (in)	44.0
			Yes	Ramp Width LT (in)	59.0	Yes	Ramp Width RT (in)	62.0
			Yes	Ramp Slope LT (%)	0.5	No	Ramp Slope RT (%)	9.4
			No	Ramp XSlope LT (%)	4.2	No	Ramp XSlope RT (%)	4.6
			N/A	Ramp Length (in)	47.0	Yes	Ramp Slope (%)	5.7
			Yes	Ramp Width (in)	62.0	No	Ramp XSlope (%)	4.1
	Surveyor Notes:		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
	LT RP < 5%		N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
PROW/ADA:			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
Not Found, R304.5.3, R304.3.2			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
			N/A	Shared Landing?	N/A			
			N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
			N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
				X Walk 1 Direction	To NW		X Walk 2 Direction	N/A
				X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	5.1		X Walk 2 Slope (%)	N/A
				X Walk 1 X Slope (%)	1.5		X Walk 2 X Slope (%)	N/A
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	N/A		Clear Space?	N/A
				Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
						N/A	Any Obstruction?	N/A
							Obstruction Type	N/A
						N/A	Storm Grate/Utility Hazard?	N/A
							Storm Grate/Utility Type	N/A
								N/A
			Yes	Surface Condition? (G/P)	Good			
				Curb Slope (%)	15.6			
Street 1 Name		StopSign						
Stop Condition-Street 1		THRIFTWOOD DR						
Street 2 Name		N/A						
Stop Condition-Street 2		N/A						
Total Cost:		\$ 1800.00						
