

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

13.2

4.3

N/A

Good

Cross Street: FARMER ST Intersection ID: 14267 Main Street: CLANTON RD Location: NE **Overall Compliance: No** 35 ADA ID: BC6450977EC7 Ramp Type: Perp Initial Pass/Fail: Fail **Severity Score:**

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

No

Yes

N/A

Yes

Compliance Description

Ramp Slope (%)

Ramp XSlope (%)

Flare Slope RT (%)

DWS Provided?

DWS Contrast?

DWS Length (in)

DWS Full Width?

DWS Offset (in)

Gutter Slope (%)

Gutter X Slope (%)

Painted X Walk2?

X Walk 2 Direction

X Walk 2 Width (in)

X Walk 2 Slope (%)

X Walk 2 X Slope (%)

Ramp inside XWalk2?

Clear Space to XWalk (in)

Storm Grate/Utility Hazard?

Storm Grate/Utility Type

Surface Condition? (G/P)

Clear Space?

Flare Traversable RT?

Flare Type RT

<u>Data</u>

112.0

47.0

N/A

Yes

To W

116.0

4.7

5.0

Yes

N/A

N/A

N/A

N/A

Flare Slope LT (%) Flare Traversable LT?


X Walk 1 X Slope (%)

Ramp inside XWalk1?

Road X Slope (%)

Any Obstructions?

Obstruction Type

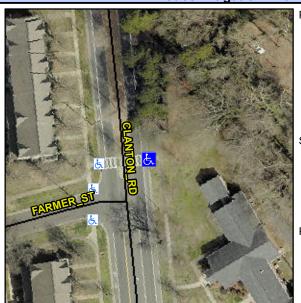

CLANTON RD Street 1 Name Stop Condition-Street 2 None N/A Street 2 Name Stop Condition-Street 1 N/A

Possible Solutions: Remove & Replace Entire Ramp. N/A Ramp Length No Ramp Width N/A Flare Type II N/A Flare Traveth N/A Landing Length N/A Landing Width N/A Landing Width N/A Landing Width N/A Landing Slo N/A Landing Slo N/A Landing Cut N/A Shared Land PROW/ADA: N/A Gutter Ponce R304 5 1 R304 2 2 N/A Gutter Lip H	th (in) n (in) LT LT (%) rsable L1
No Ramp Width N/A Flare Type I N/A Flare Slope N/A Flare Trave N/A Landing Ler Surveyor Notes: N/A Landing Slo N/A Landing Slo N/A Landing X S N/A Landing Cui N/A Shared Land PROW/ADA: N/A Gutter Ponce	n (in) LT LT (%) rsable L1
N/A Flare Type I N/A Flare Slope N/A Flare Travel N/A Landing Ler Surveyor Notes: N/A Landing Wid N/A Landing Slo N/A Landing X S N/A Landing Cut N/A Shared Land PROW/ADA: N/A Gutter Pond	LT LT (%) rsable L
N/A Flare Slope N/A Flare Traver N/A Landing Ler Surveyor Notes: N/A Landing Wid N/A Landing Slo N/A Landing X S N/A Landing Cur N/A Shared Land PROW/ADA: N/A Gutter Pond	LT (%) rsable L
N/A Flare Travel N/A Landing Ler Surveyor Notes: N/A Landing Wid N/A Landing Slo N/A Landing X S N/A Landing Cur N/A Shared Land PROW/ADA: N/A Gutter Pond	rsable Lī
N/A Landing Ler Surveyor Notes: N/A Landing Wid N/A Landing Slo N/A Landing X S N/A Landing X S N/A Landing Cut N/A Shared Land PROW/ADA: N/A Gutter Pond	
Surveyor Notes: N/A N/A Landing Wid N/A Landing Slo N/A Landing X S N/A Landing Cur N/A Shared Landing Cur N/A PROW/ADA: N/A Gutter Pond	ngth (in)
N/A N/A Landing Slo N/A Landing X S N/A Landing Cui N/A Shared Land PROW/ADA: N/A Gutter Pond	
N/A Landing X S N/A Landing Cui N/A Shared Landing PROW/ADA: N/A Gutter Pond	dth (in)
N/A Landing Cur N/A Shared Land PROW/ADA: N/A Gutter Ponce	pe (%)
PROW/ADA: N/A Gutter Pond	lope (%
PROW/ADA: N/A Gutter Pond	ъ? (Y/N
	ding?
DOOA 5 4 DOOA 0 0	ling?
R304.5.1, R304.2.2 N/A Gutter Lip H	lt (in)
N/A Painted X W	/alk1?
X Walk 1 Di	rection
N/A X Walk 1 W	idth (in)
X Walk 1 Slo	ope (%)
X Walk 1 X	Slope (%
N/A Ramp inside	≥ XWalk
Road Slope	(%)





Total Cost:



N/A

1850.00