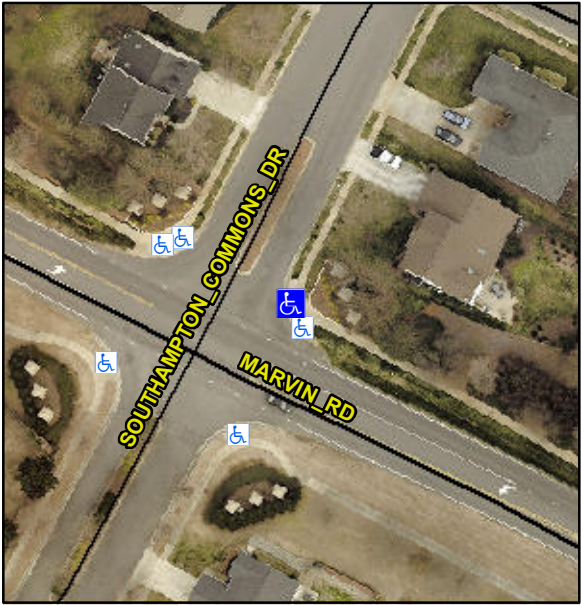


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 28386	Main Street: MARVIN_RD	Cross Street: SOUTHAMPTON_COMMONS_DR	Location: E
ADA ID: BCC9D4FC5936	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
Severity Score: 21.25			

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>
	<b>Remove &amp; Replace Entire Ramp.</b>		<b>No</b>	Ramp Length (in)	53.0
			<b>No</b>	Ramp Width (in)	41.0
			<b>N/A</b>	Flare Type LT	N/A
			<b>N/A</b>	Flare Slope LT (%)	N/A
			<b>N/A</b>	Flare Traversable LT?	N/A
			<b>N/A</b>	Landing Length (in)	N/A
			<b>N/A</b>	Landing Width (in)	N/A
			<b>N/A</b>	Landing Slope (%)	N/A
			<b>N/A</b>	Landing X Slope (%)	N/A
<p>Surveyor Notes:</p> <p><b>N/A</b></p>			<b>N/A</b>	Landing Curb? (Y/N)	N/A
			<b>N/A</b>	Shared Landing?	N/A
			<b>N/A</b>	Gutter Ponding?	N/A
			<b>N/A</b>	Gutter Lip Ht (in)	N/A
			<b>N/A</b>	Painted X Walk1?	No
			<b>To NW</b>	X Walk 1 Direction	N/A
			<b>N/A</b>	X Walk 1 Width (in)	N/A
			<b>0.4</b>	X Walk 1 Slope (%)	N/A
			<b>2.6</b>	X Walk 1 X Slope (%)	N/A
			<b>N/A</b>	Ramp inside XWalk1?	N/A
<p>PROW/ADA:</p> <p><b>Not Found, R304.5.1, R304.2.2</b></p>			<b>N/A</b>	Road Slope (%)	N/A
			<b>N/A</b>	Road X Slope (%)	N/A
			<b>N/A</b>	Any Obstructions?	N/A
				Obstruction Type	
			<b>N/A</b>		
			<b>N/A</b>		
			<b>N/A</b>		
			<b>N/A</b>		
			<b>N/A</b>		
			<b>N/A</b>		
<p>Street 1 Name</p> <p>Stop Condition-Street 2</p> <p>Street 2 Name</p> <p>Stop Condition-Street 1</p>	<b>SOUTHAMPTON COMMONS DR</b>				
	<b>StopSign</b>				
	<b>N/A</b>				
	<b>N/A</b>				
Total Cost:		\$ 1850.00			

