

## **Access Compliance Report Public Rights-of-Way** (Curb Ramps)



Data

4.5

3.2

N/A

No

N/A

2.1

1.2

N/A

N/A

N/A

N/A

N/A

8.6

Intersection ID: 31692 Main Street: JAKOBSON DR Cross Street: PHIL ONEIL DR Location: NW **Overall Compliance: No Severity Score:** 10 **ADA ID: C49D9B5624ED** Ramp Type: BlendTrans1 Initial Pass/Fail: Fail

Compliance Description

Ramp Length (in)

Ramp Width (in)

Flare Slope LT (%)

Flare Traversable LT?

Flare Type LT

N/A

No

N/A

N/A

N/A

**Codes/Mitigation Info/Possible Solution** 

## Field Measurements/Component Compliance

Yes

No

N/A

N/A

N/A

Compliance Description

Flare Type RT

Flare Slope RT (%)

Flare Traversable RT?

BlendTrans Slope (%)

BlendTrans XSlope (%)

Data

94.0

47.0


N/A

N/A

N/A



Street 1 Name Stop Condition-Street 1 Street 2 Name Stop Condition-Street 2 **JAKOBSON DR** StopSign **PHIL ONEIL DR** None Possible Solutions: Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Surveyor Notes: N/A PROW/ADA: Not Found, R304.5.1, R304.5.3

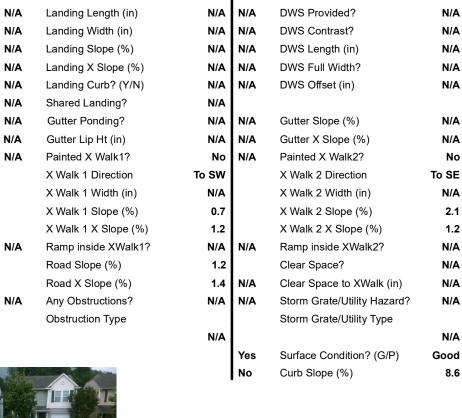





Total Cost:



3200.00