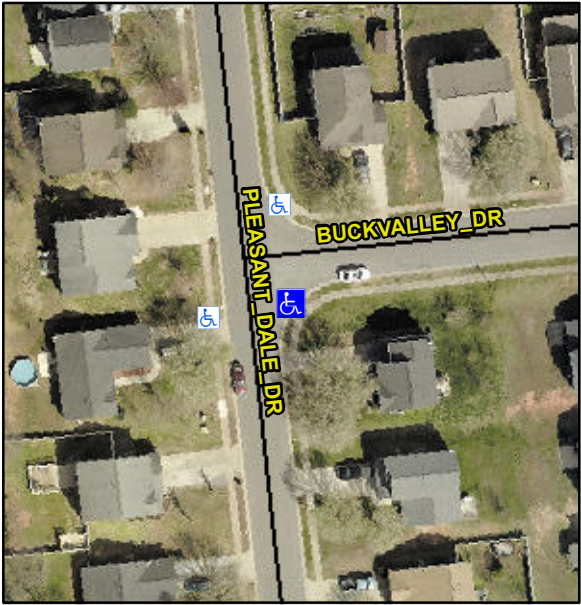


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

|   |                            |   |                        |
|---|----------------------------|---|------------------------|
| Intersection ID: 29374                  | Main Street: BUCKVALLEY_DR | Cross Street: PLEASANT_DALE_DR          | Location: SE           |
| ADA ID: C6B724FAB529                    | Ramp Type: PerpDiag        | Initial Pass/Fail: Fail                 | Overall Compliance: No |
| Severity Score: 12.5                    |                            |   |                        |
| Codes/Mitigation Info/Possible Solution |                            | Field Measurements/Component Compliance |                        |

|  |  |     |                       |      |     |                             |      |
|--|--|-----|-----------------------|------|-----|-----------------------------|------|
|  | Possible Solutions:  |     |                       |      |     |                             |      |
|  | Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. | N/A | Ramp Length (in)      | 47.0 | Yes | Ramp Slope (%)              | 5.2  |
|  |  | Yes | Ramp Width (in)       | 48.0 | No  | Ramp XSlope (%)             | 5.1  |
|  |  | N/A | Flare Type LT         | N/A  | N/A | Flare Type RT               | N/A  |
|  |  | N/A | Flare Slope LT (%)    | N/A  | N/A | Flare Slope RT (%)          | N/A  |
|  |  | N/A | Flare Traversable LT? | N/A  | N/A | Flare Traversable RT?       | N/A  |
|  |  | N/A | Landing Length (in)   | N/A  | N/A | DWS Provided?               | N/A  |
|  |  | N/A | Landing Width (in)    | N/A  | N/A | DWS Contrast?               | N/A  |
|  |  | N/A | Landing Slope (%)     | N/A  | N/A | DWS Length (in)             | N/A  |
|  |  | N/A | Landing X Slope (%)   | N/A  | N/A | DWS Full Width?             | N/A  |
|  |  | N/A | Landing Curb? (Y/N)   | N/A  | N/A | DWS Offset (in)             | N/A  |
|  |  | N/A | Shared Landing?       | N/A  |     |                             |      |
|  |  | N/A | Gutter Ponding?       | N/A  | N/A | Gutter Slope (%)            | N/A  |
|  |  | N/A | Gutter Lip Ht (in)    | N/A  | N/A | Gutter X Slope (%)          | N/A  |
|  |  | N/A | Painted X Walk1?      | No   | N/A | Painted X Walk2?            | No   |
|  |  |     | X Walk 1 Direction    | To N |     | X Walk 2 Direction          | To W |
|  |  | N/A | X Walk 1 Width (in)   | N/A  | N/A | X Walk 2 Width (in)         | N/A  |
|  |  |     | X Walk 1 Slope (%)    | 8.0  |     | X Walk 2 Slope (%)          | 6.7  |
|  |  |     | X Walk 1 X Slope (%)  | 2.9  |     | X Walk 2 X Slope (%)        | 5.7  |
|  |  | N/A | Ramp inside XWalk1?   | N/A  | N/A | Ramp inside XWalk2?         | N/A  |
| <p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.5.3</p>    |  |     | Road Slope (%)        | 2.7  | N/A | Clear Space?                | N/A  |
|  |  |     | Road X Slope (%)      | 5.5  | N/A | Clear Space to XWalk (in)   | N/A  |
|  |  | N/A | Any Obstructions?     | N/A  | N/A | Storm Grate/Utility Hazard? | N/A  |
|  |  |     | Obstruction Type      |      |     | Storm Grate/Utility Type    |      |
|  |  |     |                       |      | N/A |                             | N/A  |
|  |  |     |                       |      | Yes | Surface Condition? (G/P)    | Good |



Total Cost: \$ 3200.00