


Intersection ID: 10037015	Main Street: S_TRYON_ST	Cross Street: N/A	Location:	E
ADA ID: C6F2CC4F6AE8	Ramp Type: BlendTrans1	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 33.75

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance

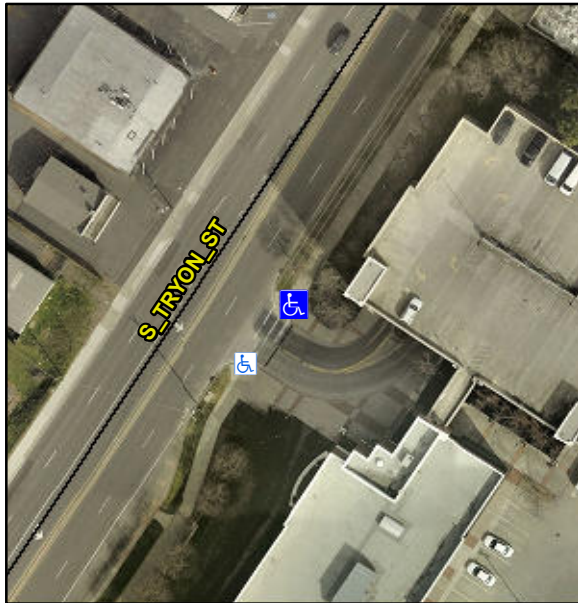

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.1, R304.5.3

Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.	N/A	Ramp Length (in)	96.0	Yes	BlendTrans Slope (%)	1.3	
	No	Ramp Width (in)	38.0	No	BlendTrans XSlope (%)	14.0	
	N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A	
	N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A	
	N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A	
	N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A	
	N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A	
	N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A	
	N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A	
	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	
	N/A	Shared Landing?	N/A				
	N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A	
Surveyor Notes: N/A	N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A	
	N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	Yes	
		X Walk 1 Direction	To W		X Walk 2 Direction	To SW	
		X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	52.0	
		X Walk 1 Slope (%)	10.3		X Walk 2 Slope (%)	1.7	
		X Walk 1 X Slope (%)	2.4		X Walk 2 X Slope (%)	8.0	
	N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	Yes	
		Road Slope (%)	10.0		Clear Space?	N/A	
		Road X Slope (%)	4.3	N/A	Clear Space to XWalk (in)	N/A	
	N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
		Obstruction Type			Storm Grate/Utility Type		
			N/A			N/A	
PROW/ADA: Not Found, R304.5.1, R304.5.3				Yes	Surface Condition? (G/P)	Good	
				No	Curb Slope (%)	15.3	
Total Cost:	\$	3200.00					

