


Intersection ID: 16569	Main Street: FOREST_PARK_DR	Cross Street: PRINCETON_AV	Location:	NW
ADA ID: C954591E6A6D	Ramp Type: ParaDiag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 26.25

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

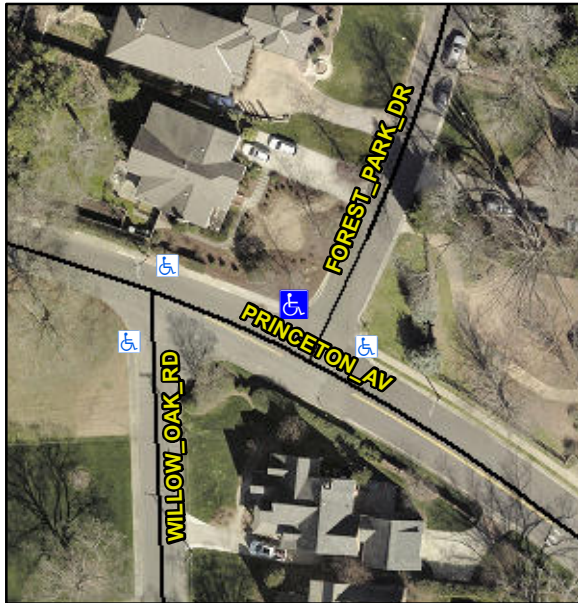

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:


N/A

PROW/ADA:

R304.3.2, R304.5.3

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	33.0	N/A	Ramp Length RT (in)	40.0
Yes	Ramp Width LT (in)	49.0	Yes	Ramp Width RT (in)	50.0
No	Ramp Slope LT (%)	14.5	No	Ramp Slope RT (%)	10.3
No	Ramp XSlope LT (%)	4.0	No	Ramp XSlope RT (%)	4.1
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	8.4		X Walk 2 Slope (%)	2.3
	X Walk 1 X Slope (%)	3.8		X Walk 2 X Slope (%)	12.2
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	10.3	N/A	Clear Space?	N/A
	Road X Slope (%)	5.1	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	6.5

Total Cost: \$ 3200.00

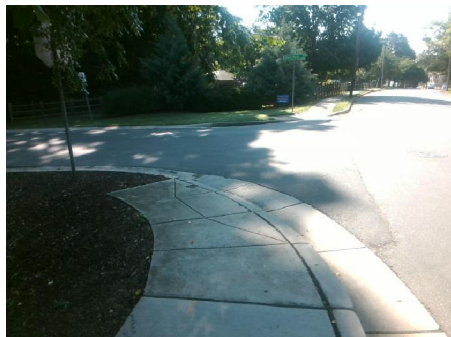

Street 1 Name	PRINCETON AV
Stop Condition-Street 1	None
Street 2 Name	FOREST PARK DR
Stop Condition-Street 2	StopSign