

## Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

6.5

3.6

N/A

No

N/A

1.7

0.1

To NW

Intersection ID: 45733 Main Street: REDWOOD\_VALLEY\_LN Cross Street: DALTREY\_LN Location: SE

ADA ID: CAEC5E4F879D Ramp Type: PerpDiag Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 10

Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance

Yes

No

N/A

Compliance Description

Ramp Slope (%)

Flare Type RT

Ramp XSlope (%)

Flare Slope RT (%)

**DWS Provided?** 

**DWS Contrast?** 

DWS Length (in)

DWS Full Width?

DWS Offset (in)

Gutter Slope (%)

Gutter X Slope (%)

Painted X Walk2?

X Walk 2 Direction

X Walk 2 Width (in)

X Walk 2 Slope (%)

X Walk 2 X Slope (%)

Flare Traversable RT?

Data

48.0

45.0

N/A


No

N/A

1.4

1.0

To NE

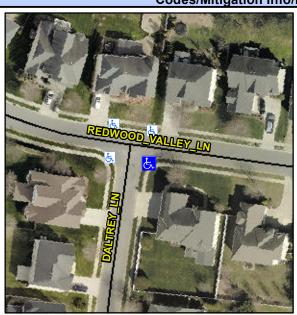

Street 1 Name REDWOOD VALLEY LN
Stop Condition-Street 2 None
Street 2 Name DALTREY LN
Stop Condition-Street 1 StopSign

Possible Solutions:

Remove & Replace Curb Ramp With
Two New Directional Ramps or
Equivalent.

N/A

Surveyor Notes:

PROW/ADA:

Not Found, R304.5.1, R304.5.3

Total Cost:		





Compliance Description

Ramp Length (in)

Ramp Width (in)

Flare Slope LT (%)

Landing Length (in)

Landing Width (in)

Landing Slope (%)

Landing X Slope (%)

Landing Curb? (Y/N)

Shared Landing?

Gutter Ponding?

Gutter Lip Ht (in)

Painted X Walk1?

X Walk 1 Direction

X Walk 1 Width (in)

X Walk 1 Slope (%)

X Walk 1 X Slope (%)

Flare Traversable LT?

Flare Type LT

N/A

No

N/A



