

ADA ID: D048C40D2820

## **Access Compliance Report Public Rights-of-Way** (Curb Ramps)



Data

6.8

5.2

N/A

Yes

To W

112.0

4.8

0.7

Yes

N/A

N/A

N/A

N/A

Good

Severity Score: 21.25

Intersection ID: 18776 Main Street: SOUTH BV **Cross Street: TYVOLA RD** Location: SE

**Codes/Mitigation Info/Possible Solution** 

Ramp Type: PerpDiag

Field Measurements/Component Compliance

Yes

No

N/A

Yes

Compliance Description

Ramp Slope (%)

Flare Type RT

Ramp XSlope (%)

Flare Slope RT (%)

**DWS Provided?** 

**DWS Contrast?** 

DWS Length (in)

DWS Full Width?

DWS Offset (in)

Gutter Slope (%)

Gutter X Slope (%)

Painted X Walk2?

X Walk 2 Direction

X Walk 2 Width (in)

X Walk 2 Slope (%)

X Walk 2 X Slope (%)

Ramp inside XWalk2?

Clear Space to XWalk (in)

Storm Grate/Utility Hazard?

Storm Grate/Utility Type

Surface Condition? (G/P)

Clear Space?

Flare Traversable RT?

Data

73.0

47.0

N/A

Yes

To N

118.0

5.4

7.5

Yes


4.5

5.5

N/A

N/A

**Overall Compliance: No** 

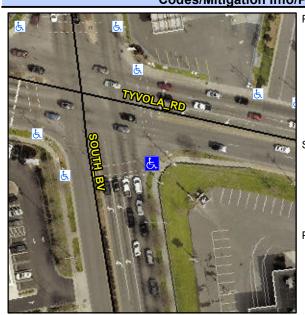

Street 1 Name **TYVOLA RD** Stop Condition-Street 2 Signal **SOUTH BV** Street 2 Name Stop Condition-Street 1 Signal Possible Solutions: Compliance Description N/A Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Surveyor Notes: N/A PROW/ADA: R304.5.1, R304.5.3

Total Cost: 3200.00

		1 3 ( )
N	No	Ramp Width (in)
N	N/A	Flare Type LT
N	N/A	Flare Slope LT (%)
1	N/A	Flare Traversable LT?
N	N/A	Landing Length (in)
1	N/A	Landing Width (in)
1	N/A	Landing Slope (%)
N	N/A	Landing X Slope (%)
1	N/A	Landing Curb? (Y/N)
1	N/A	Shared Landing?
ı	N/A	Gutter Ponding?
N	N/A	Gutter Lip Ht (in)
1	N/A	Painted X Walk1?
		X Walk 1 Direction
1	N/A	X Walk 1 Width (in)
		X Walk 1 Slope (%)
		X Walk 1 X Slope (%)
N	N/A	Ramp inside XWalk1?
		Road Slope (%)
		Road X Slope (%)
ı	N/A	Any Obstructions?

Initial Pass/Fail: Fail

Ramp Length (in)

**Obstruction Type** 







