

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

55.0

59.0

12.3

1.4

N/A

8.1

N/A

No

N/A

2.8

6.0

N/A

N/A

To SW

Intersection ID: N/A Main Street: CAMPBELL DR Cross Street: DRIFTWOOD DR SE Location: **Overall Compliance: No Severity Score:** 0 ADA ID: D048DC13F72A Ramp Type: Combination1Diag Initial Pass/Fail: Fail

Codes/Mitigation Info/Possible Solution


Field Measurements/Component Compliance



Street 1 Name Stop Condition-Street 1 Street 2 Name Stop Condition-Street 2

StopSign **CAMPBELL DR** None DRIFTWOOD DR Possible Solutions: Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Surveyor Notes: N/A PROW/ADA: R304.5.1, R304.5.1, R304.2.2, R304.5.3, R304.3.2

Total Cost: 3200.00

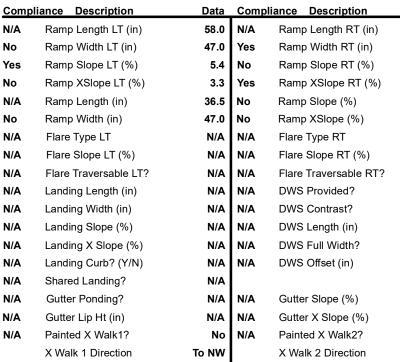

N/A

0.0

3.5

N/A

6.5

1.2

N/A

N/A







N/A

X Walk 1 Width (in)

X Walk 1 Slope (%)

X Walk 1 X Slope (%)

Ramp inside XWalk1?

Road Slope (%)

Clear Space to XWalk (in) N/A N/A Any Obstruction? N/A **Obstruction Type** N/A N/A Storm Grate/Utility Hazard? N/A Storm Grate/Utility Type N/A Yes Surface Condition? (G/P) Good 22.6 Curb Slope (%)

X Walk 2 Width (in)

X Walk 2 Slope (%)

X Walk 2 X Slope (%)

Ramp inside XWalk2?

Clear Space?