


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 11457	Main Street: TRYON-CHURCH CONNECTOR ST	Cross Street: N_CHURCH_ST	Location: NW
ADA ID: D5555C3A1F04	Ramp Type: ParaDiag	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 0.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

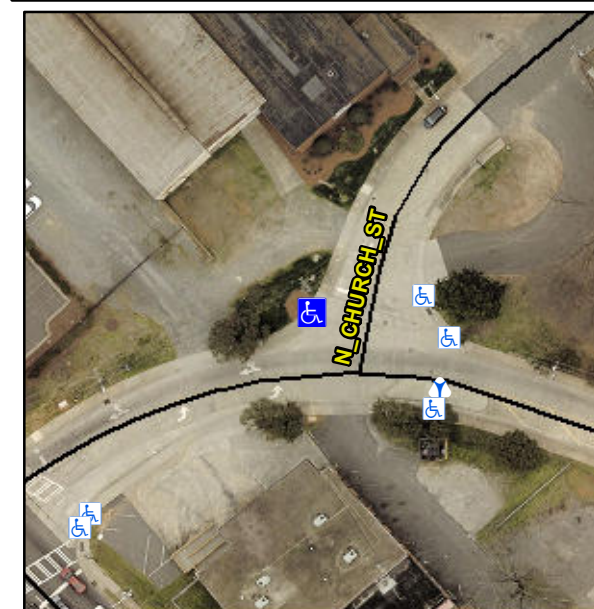

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

RT RP < 5%

PROW/ADA:

R304.5.3

Total Cost:

\$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	88.0	N/A	Ramp Length RT (in)	63.0
Yes	Ramp Width LT (in)	60.0	Yes	Ramp Width RT (in)	60.0
Yes	Ramp Slope LT (%)	6.7	Yes	Ramp Slope RT (%)	2.5
No	Ramp XSlope LT (%)	3.1	Yes	Ramp XSlope RT (%)	1.0
Yes	Landing Length (in)	60.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.5	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	2.3	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	4.9
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.8
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To S		X Walk 2 Direction	To E
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.0		X Walk 2 Slope (%)	0.2
	X Walk 1 X Slope (%)	2.2		X Walk 2 X Slope (%)	2.4
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.5	N/A	Clear Space?	Yes
	Road X Slope (%)	1.0	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	17.7

