


## Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 30402Main Street:WOODLAWN\_RDCross Street:PARK\_RD\_SHOPPING\_CENTER\_DRLocation:NWADA ID: D6D9EF1CD617Ramp Type:PerpInitial Pass/Fail:FailOverall Compliance:NoSeverity Score:37.5

## **Codes/Mitigation Info/Possible Solution**

## Field Measurements/Component Compliance

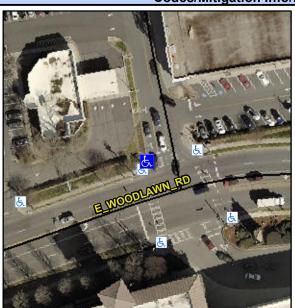

| Street 1 Name           | PARKWTOWNE VILLAGE DR |
|-------------------------|-----------------------|
| Stop Condition-Street 2 | Signal                |
| Street 2 Name           | N/A                   |
| Stop Condition-Street 1 | N/A                   |

| o/Possible Solution           |    |         | Field Measurements/Component Compliance |                       |       |                      |                             |      |  |
|-------------------------------|----|---------|---|-----------------------|-------|----------------------|-----------------------------|------|--|
| Possible Solutions:           |    |         | Comp                                    | liance Description    | Data  | Comp                 | liance Description          | Data |  |
| Remove & Replace Entire Ramp. | ). | N/A     | Ramp Length (in)                        | 24.0                  | No    | Ramp Slope (%)       | 9.0                         |      |  |
|                               | •  |         | Yes                                     | Ramp Width (in)       | 48.0  | No                   | Ramp XSlope (%)             | 7.9  |  |
|                               |    |         | N/A                                     | Flare Type LT         | N/A   | N/A                  | Flare Type RT               | N/A  |  |
| -                             |    |         | N/A                                     | Flare Slope LT (%)    | N/A   | N/A                  | Flare Slope RT (%)          | N/A  |  |
| •                             |    |         | N/A                                     | Flare Traversable LT? | N/A   | N/A                  | Flare Traversable RT?       | N/A  |  |
|                               |    |         | N/A                                     | Landing Length (in)   | N/A   | N/A                  | DWS Provided?               | N/A  |  |
| Surveyor Notes:               |    |         | N/A                                     | Landing Width (in)    | N/A   | N/A                  | DWS Contrast?               | N/A  |  |
| N/A                           |    | N/A     | Landing Slope (%)                       | N/A                   | N/A   | DWS Length (in)      | N/A                         |      |  |
|                               |    | N/A     | Landing X Slope (%)                     | N/A                   | N/A   | DWS Full Width?      | N/A                         |      |  |
|                               |    | N/A     | Landing Curb? (Y/N)                     | N/A                   | N/A   | DWS Offset (in)      | N/A                         |      |  |
|                               |    | N/A     | Shared Landing?                         | N/A                   |       |                      |                             |      |  |
| PROW/ADA:                     |    |         | N/A                                     | Gutter Ponding?       | N/A   | N/A                  | Gutter Slope (%)            | N/A  |  |
| Not Found, R304.2.2, R304.5.3 |    | N/A     | Gutter Lip Ht (in)                      | N/A                   | N/A   | Gutter X Slope (%)   | N/A                         |      |  |
|                               |    |         | N/A                                     | Painted X Walk1?      | Yes   | N/A                  | Painted X Walk2?            | N/A  |  |
|                               |    |         |   | X Walk 1 Direction    | To E  |                      | X Walk 2 Direction          | N/A  |  |
|                               |    |         | N/A                                     | X Walk 1 Width (in)   | 103.0 | N/A                  | X Walk 2 Width (in)         | N/A  |  |
|                               |    |         |   | X Walk 1 Slope (%)    | 1.3   |                      | X Walk 2 Slope (%)          | N/A  |  |
|                               |    |         | X Walk 1 X Slope (%)                    | 1.1                   |       | X Walk 2 X Slope (%) | N/A                         |      |  |
|                               |    | N/A     | Ramp inside XWalk1?                     | Yes                   | N/A   | Ramp inside XWalk2?  | N/A                         |      |  |
|                               |    |         | Road Slope (%)                          | N/A                   | N/A   | Clear Space?         | N/A                         |      |  |
|                               |    |         |   | Road X Slope (%)      | N/A   | N/A                  | Clear Space to XWalk (in)   | N/A  |  |
|                               |    |         | N/A                                     | Any Obstructions?     | N/A   | N/A                  | Storm Grate/Utility Hazard? | N/A  |  |
| Total Cost: \$                | \$ | 1850.00 |   | Obstruction Type      |       | i                    | Storm Grate/Utility Type    |      |  |
|                               |    |         |   |                       | N/A   | 1                    |                             | N/A  |  |
|                               |    |         |   |                       |       | Yes                  | Surface Condition? (G/P)    | Good |  |
|                               |    |         |   |                       |       |                      |                             |      |  |





