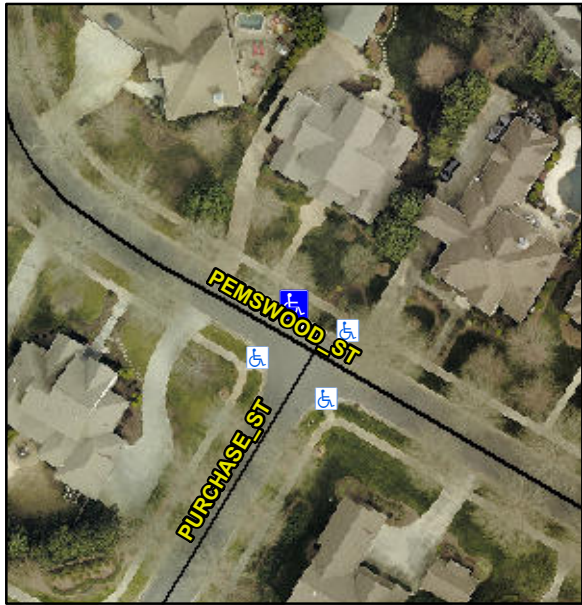


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 28272	Main Street: PEMSWOOD_ST	Cross Street: PURCHASE_ST	Location:	N
ADA ID: D81779C25DE0	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 10

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance							
	Possible Solutions:		<b>Compliance</b>			<b>Description</b>			<b>Data</b>	
	<b>Remove &amp; Replace Entire Ramp.</b>		<b>N/A</b>	Ramp Length (in)	<b>94.0</b>	<b>Yes</b>	Ramp Slope (%)	<b>5.3</b>		
			<b>Yes</b>	Ramp Width (in)	<b>53.0</b>	<b>Yes</b>	Ramp XSlope (%)	<b>1.6</b>		
			<b>N/A</b>	Flare Type LT	<b>None</b>	<b>N/A</b>	Flare Type RT	<b>N/A</b>		
			<b>N/A</b>	Flare Slope LT (%)	<b>N/A</b>	<b>N/A</b>	Flare Slope RT (%)	<b>N/A</b>		
			<b>N/A</b>	Flare Traversable LT?	<b>N/A</b>	<b>N/A</b>	Flare Traversable RT?	<b>N/A</b>		
			<b>Yes</b>	Landing Length (in)	<b>54.0</b>	<b>No</b>	DWS Provided?	<b>No</b>		
			<b>Yes</b>	Landing Width (in)	<b>53.0</b>	<b>N/A</b>	DWS Contrast?	<b>No</b>		
			<b>No</b>	Landing Slope (%)	<b>3.7</b>	<b>N/A</b>	DWS Length (in)	<b>N/A</b>		
			<b>No</b>	Landing X Slope (%)	<b>2.2</b>	<b>N/A</b>	DWS Full Width?	<b>No</b>		
Surveyor Notes:		<b>N/A</b>			<b>N/A</b>			<b>N/A</b>		
PROW/ADA:		<b>R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305</b>			<b>No</b>			<b>N/A</b>		
					<b>Yes</b>			<b>Gutter Ponding?</b>		
					<b>Yes</b>			<b>Gutter Lip Ht (in)</b>		
					<b>N/A</b>			<b>Painted X Walk1?</b>		
					<b>To SW</b>			<b>X Walk 2 Direction</b>		
					<b>N/A</b>			<b>X Walk 2 Width (in)</b>		
					<b>3.9</b>			<b>X Walk 2 Slope (%)</b>		
					<b>0.6</b>			<b>X Walk 2 X Slope (%)</b>		
					<b>N/A</b>			<b>Ramp inside XWalk2?</b>		
					<b>N/A</b>			<b>Clear Space?</b>		
					<b>N/A</b>			<b>Clear Space to XWalk (in)</b>		
					<b>Yes</b>			<b>Storm Grate/Utility Hazard?</b>		
								<b>Storm Grate/Utility Type</b>		
					<b>N/A</b>			<b>N/A</b>		
					<b>Yes</b>			<b>Surface Condition? (G/P)</b>		
								<b>Good</b>		
Total Cost:		\$ 1850.00								

