


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 16755	Main Street: DICKINSON_PL	Cross Street: PRINCETON_AV	Location: S
ADA ID: DC09B1C5AF85	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 5.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

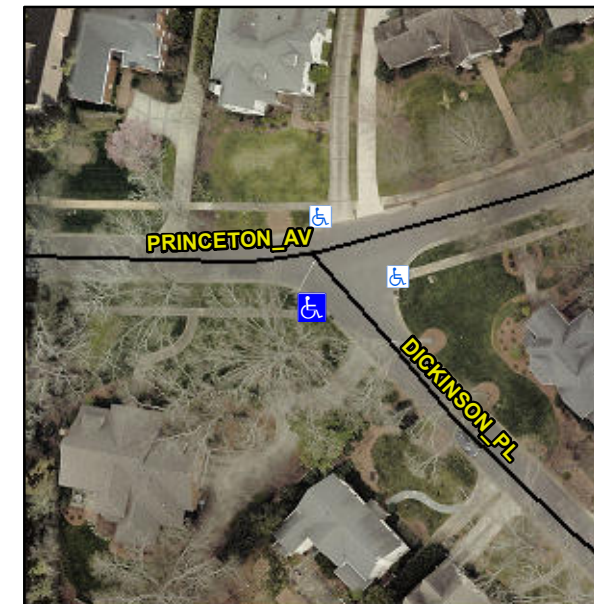

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

ASP LIP 0.5

PROW/ADA:

Not Found, R304.5.3, R305.2, R304.5.4

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	67.0	Yes	BlendTrans Slope (%)	2.8
Yes	Ramp Width (in)	53.5	No	BlendTrans XSlope (%)	3.0
N/A	Flare Type LT	None	N/A	Flare Type RT	None
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	61.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	53.5	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.7	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	3.5	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	4.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	9.5
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.1
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NE		X Walk 2 Direction	To N
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	5.3		X Walk 2 Slope (%)	4.8
	X Walk 1 X Slope (%)	0.5		X Walk 2 X Slope (%)	0.9
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.4		Clear Space?	Yes
	Road X Slope (%)	6.5	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	17.6

Street 1 Name DICKINSON PL
 Stop Condition-Street 1 StopSign
 Street 2 Name PRINCETON AV
 Stop Condition-Street 2 None

