


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 32240	Main Street: RICHPORT_DR	Cross Street: WESTGARTH_AV	Location: W
ADA ID: DFCB9317F099	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 15.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

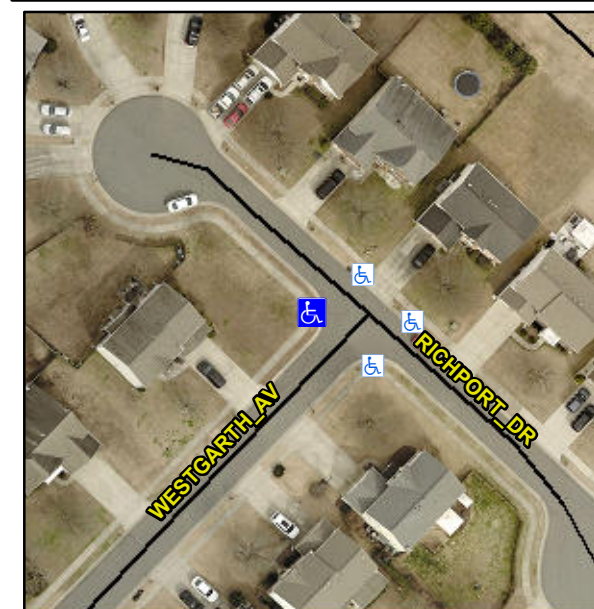

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

DAMAGED GTR

PROW/ADA:

Not Found, R304.5.3, R304.2.1, R305, R304.5.4

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	48.0	Yes	BlendTrans Slope (%)	2.2
Yes	Ramp Width (in)	67.0	No	BlendTrans XSlope (%)	3.7
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	1.2	N/A	Flare Slope RT (%)	7.1
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
No	Landing Length (in)	46.0	No	DWS Provided?	No
Yes	Landing Width (in)	63.0	N/A	DWS Contrast?	No
Yes	Landing Slope (%)	2.0	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	2.5	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	7.5
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	4.9
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SE		X Walk 2 Direction	To NE
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.8		X Walk 2 Slope (%)	4.7
	X Walk 1 X Slope (%)	3.8		X Walk 2 X Slope (%)	1.9
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	3.6		Clear Space?	Yes
	Road X Slope (%)	2.1	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	14.3

