


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 28773	Main Street: ROYAL_HIGHLANDS_CT	Cross Street: THATCHER_HALL_CT	Location: SW
ADA ID: E32F240E3496	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 17.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

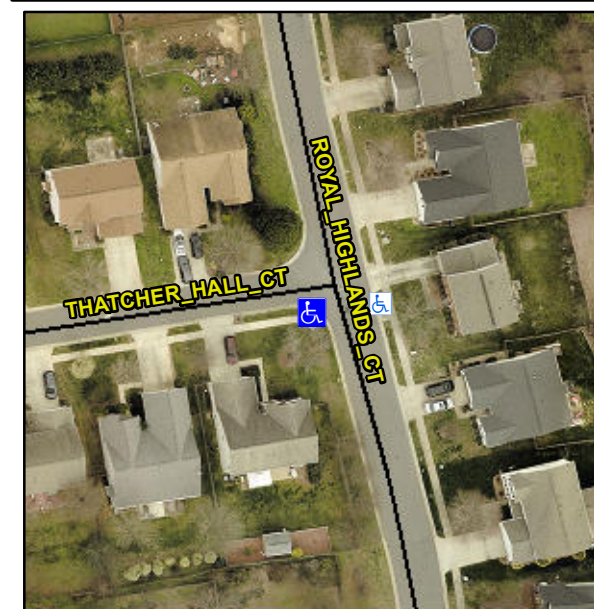

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3, R305, R302.7.2

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	42.0	Yes	BlendTrans Slope (%)	3.4
Yes	Ramp Width (in)	51.0	No	BlendTrans XSlope (%)	4.4
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	9.2	N/A	Flare Slope RT (%)	1.5
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	48.0	No	DWS Provided?	No
Yes	Landing Width (in)	51.0	N/A	DWS Contrast?	No
Yes	Landing Slope (%)	1.7	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	3.1	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.5
No	Gutter Lip Ht (in)	0.3	No	Gutter X Slope (%)	4.2
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To E		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.9		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.9		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.9		Clear Space?	Yes
	Road X Slope (%)	2.9	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	5.1

