

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

11.2

1.3

N/A

Good

Cross Street: MT HOLLY-HUNTERSVILLE RD Intersection ID: 3509 Main Street: COPENHAGEN LN Location: SE 12.5 **ADA ID: E4C5AD7AEEA1** Ramp Type: Perp Initial Pass/Fail: Fail **Overall Compliance: No Severity Score:**

Compliance Description

N/A

Yes

N/A

1850.00

Ramp Length (in)

Ramp Width (in)

Flare Slope LT (%)

Landing Length (in)

Landing Width (in)

Landing Slope (%)

Landing X Slope (%)

Landing Curb? (Y/N)

Shared Landing?

Gutter Ponding?

Gutter Lip Ht (in)

Painted X Walk1?

X Walk 1 Direction

X Walk 1 Width (in)

X Walk 1 Slope (%)

X Walk 1 X Slope (%)

Ramp inside XWalk1?

Road Slope (%)

Road X Slope (%)

Any Obstructions?

Obstruction Type

Flare Traversable LT?

Flare Type LT

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

No

Yes

N/A

Yes

Compliance Description

Ramp Slope (%)

Flare Type RT

Ramp XSlope (%)

Flare Slope RT (%)

DWS Provided?

DWS Contrast?

DWS Length (in)

DWS Full Width?

DWS Offset (in)

Gutter Slope (%)

Gutter X Slope (%)

Painted X Walk2?

X Walk 2 Direction

X Walk 2 Width (in)

X Walk 2 Slope (%)

X Walk 2 X Slope (%)

Ramp inside XWalk2?

Clear Space to XWalk (in)

Storm Grate/Utility Type

Surface Condition? (G/P)

Storm Grate/Utility Hazard?

Clear Space?

Flare Traversable RT?

Data

96.0

78.0

N/A

No

To W

N/A

0.8

0.7


N/A

0.7

0.8

N/A

N/A

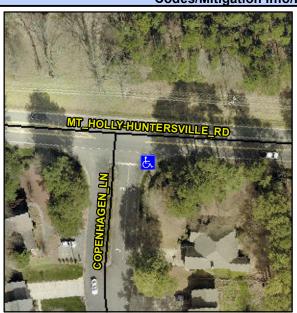

Street 1 Name	COPENHAGEN LN
Stop Condition-Street 2	StopSign
Street 2 Name	N/A
Stop Condition-Street 1	N/A

<u> </u>	1 033ibic Colation
	Possible Solutions:
	Remove & Replace Entire Ramp.
-	
SERVICE	
を	
	Surveyor Notes:
	N/A
-	
	PROW/ADA:
	R304.2.2

Total Cost:	





