


# Access Compliance Report Public Rights-of-Way (Curb Ramps)

|                      |                          |                             |                                              |
|----------------------|--------------------------|-----------------------------|----------------------------------------------|
| Intersection ID: N/A | Main Street: MORABLIN_DR | Cross Street: MERSINGTON_LN | Location: NE                                 |
| ADA ID: E712FD2A0DDA | Ramp Type: PerpDiag      | Initial Pass/Fail: Pass     | Overall Compliance: No<br>Severity Score: 15 |

### Codes/Mitigation Info/Possible Solution

### Field Measurements/Component Compliance

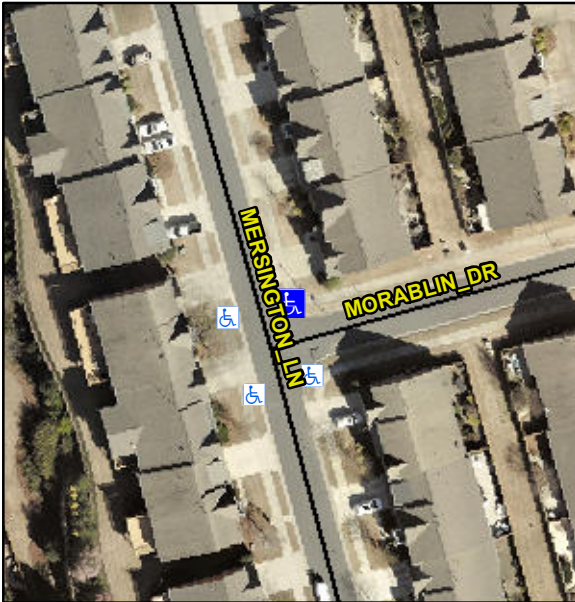

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

**R304.2.2-Perp, R304.3.2-Para, R305, R304.5.4**

| Compliance | Description           | Data   | Compliance | Description                 | Data |
|------------|-----------------------|--------|------------|-----------------------------|------|
| N/A        | Ramp Length (in)      | 46.0   | Yes        | Ramp Slope (%)              | 7.0  |
| Yes        | Ramp Width (in)       | 48.0   | Yes        | Ramp XSlope (%)             | 1.3  |
| N/A        | Flare Type LT         | Sloped | N/A        | Flare Type RT               | N/A  |
| N/A        | Flare Slope LT (%)    | 4.0    | Yes        | Flare Slope RT (%)          | 5.2  |
| N/A        | Flare Traversable LT? | Yes    | N/A        | Flare Traversable RT?       | Yes  |
| Yes        | Landing Length (in)   | 59.0   | No         | DWS Provided?               | No   |
| Yes        | Landing Width (in)    | 48.0   | N/A        | DWS Contrast?               | No   |
| No         | Landing Slope (%)     | 3.8    | N/A        | DWS Length (in)             | N/A  |
| Yes        | Landing X Slope (%)   | 0.6    | N/A        | DWS Full Width?             | No   |
| N/A        | Landing Curb? (Y/N)   | No     | N/A        | DWS Offset (in)             | N/A  |
| N/A        | Shared Landing?       | No     |            |                             |      |
| Yes        | Gutter Ponding?       | No     | No         | Gutter Slope (%)            | 6.4  |
| Yes        | Gutter Lip Ht (in)    | 0.0    | Yes        | Gutter X Slope (%)          | 0.3  |
| N/A        | Painted X Walk1?      | No     | N/A        | Painted X Walk2?            | No   |
|            | X Walk 1 Direction    | To W   |            | X Walk 2 Direction          | To S |
| N/A        | X Walk 1 Width (in)   | N/A    | N/A        | X Walk 2 Width (in)         | N/A  |
|            | X Walk 1 Slope (%)    | 2.6    |            | X Walk 2 Slope (%)          | 1.9  |
|            | X Walk 1 X Slope (%)  | 0.1    |            | X Walk 2 X Slope (%)        | 1.3  |
| N/A        | Ramp inside XWalk1?   | N/A    | N/A        | Ramp inside XWalk2?         | N/A  |
|            | Road Slope (%)        | 2.1    | N/A        | Clear Space?                | Yes  |
|            | Road X Slope (%)      | 0.1    | N/A        | Clear Space to XWalk (in)   | N/A  |
| Yes        | Any Obstructions?     | No     | Yes        | Storm Grate/Utility Hazard? | No   |
|            | Obstruction Type      |        |            | Storm Grate/Utility Type    |      |
|            |                       |        | N/A        |                             | N/A  |
|            |                       |        | Yes        | Surface Condition? (G/P)    | Good |

Total Cost: \$ 3950.00

Street 1 Name: MERSINGTON LN  
 Stop Condition-Street 2: None  
 Street 2 Name: MORABLIN DR  
 Stop Condition-Street 1: StopSign

