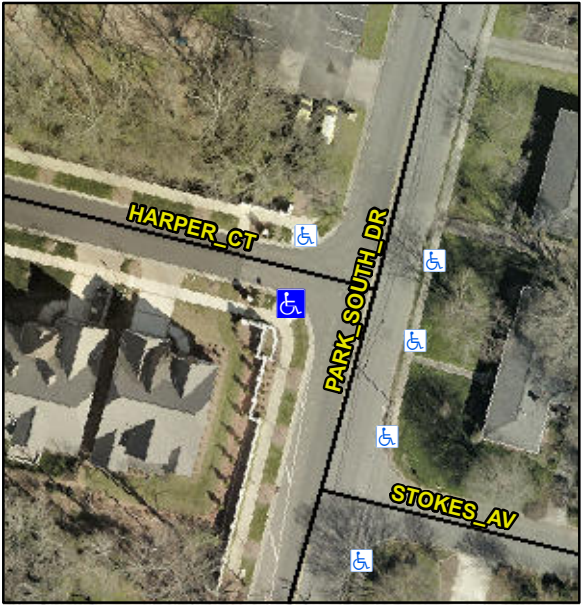


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 53210	Main Street: HARPER_CT	Cross Street: PARK_SOUTH_DR	Location: SW
ADA ID: E8CCE5EB2F47	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No Severity Score: 13.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
	Possible Solutions:		Compliance	Description	Data	
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	94.0	No
			Yes	Ramp Width (in)	48.0	No
			N/A	Flare Type LT	N/A	N/A
			N/A	Flare Slope LT (%)	N/A	N/A
			N/A	Flare Traversable LT?	N/A	N/A
			N/A	Landing Length (in)	N/A	N/A
			N/A	Landing Width (in)	N/A	N/A
			N/A	Landing Slope (%)	N/A	N/A
			N/A	Landing X Slope (%)	N/A	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>R304.2.2, R304.5.3</p>			N/A	Flare Type RT	N/A	N/A
			N/A	Flare Slope RT (%)	N/A	N/A
			N/A	Flare Traversable RT?	N/A	N/A
			N/A	DWS Provided?	N/A	N/A
			N/A	DWS Contrast?	N/A	N/A
			N/A	DWS Length (in)	N/A	N/A
			N/A	DWS Full Width?	N/A	N/A
			N/A	DWS Offset (in)	N/A	N/A
			N/A	Shared Landing?	N/A	N/A
			N/A	Gutter Ponding?	N/A	N/A
<p>Total Cost:</p> <p>\$ 3200.00</p>			N/A	Gutter Lip Ht (in)	N/A	N/A
			N/A	Painted X Walk1?	No	N/A
				X Walk 1 Direction	To E	X Walk 2 Direction
			N/A	X Walk 1 Width (in)	N/A	N/A
				X Walk 1 Slope (%)	3.5	X Walk 2 Slope (%)
				X Walk 1 X Slope (%)	1.2	X Walk 2 X Slope (%)
			N/A	Ramp inside XWalk1?	N/A	N/A
				Road Slope (%)	1.9	N/A
				Road X Slope (%)	3.7	N/A
			N/A	Any Obstructions?	N/A	N/A
				Obstruction Type		
					N/A	N/A
					Yes	Surface Condition? (G/P)
						Good

