


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 16132	Main Street: S_TRYON_ST	Cross Street: W_CAMA_ST	Location: W
ADA ID: EA3CCAF80C12	Ramp Type: BlendTrans2	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 2.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

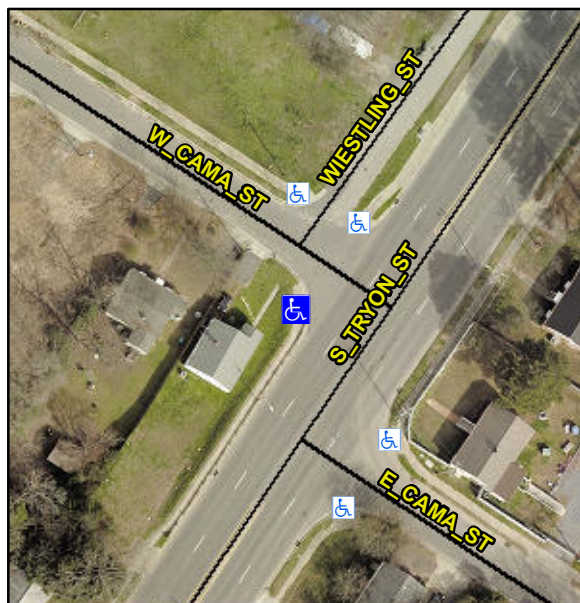

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3, R304.2.3, R305.1.4

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	67.0	Yes	BlendTrans Slope (%)	2.3
Yes	Ramp Width (in)	64.0	No	BlendTrans XSlope (%)	3.4
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
No	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	No
N/A	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
N/A	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
N/A	Landing Slope (%)	N/A	Yes	DWS Length (in)	25.5
N/A	Landing X Slope (%)	N/A	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.1
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.1
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SE		X Walk 2 Direction	To NE
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.4		X Walk 2 Slope (%)	3.3
	X Walk 1 X Slope (%)	3.8		X Walk 2 X Slope (%)	0.3
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.1		Clear Space?	Yes
	Road X Slope (%)	3.5	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	5.2

