


Intersection ID: 12687	Main Street: BROWNING_AV	Cross Street: NASSAU_BV	Location:	SE
ADA ID: EC975779B2CE	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 21.25

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

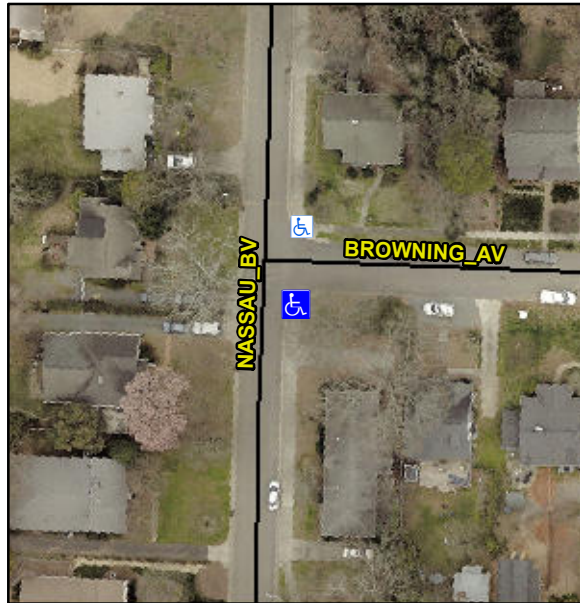

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.1, R304.5.3

Possible Solutions:			Compliance	Description	Data	Compliance	Description	Data
Remove & Replace Entire Ramp.	N/A	Ramp Length (in)	72.0	Yes	Ramp Slope (%)	7.0		
	No	Ramp Width (in)	42.5	No	Ramp XSlope (%)	6.1		
	N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A		
	N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A		
	N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A		
	N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A		
	N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A		
	N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A		
	N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A		
	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A		
Surveyor Notes:	N/A							
PROW/ADA:	N/A	Shared Landing?	N/A	N/A	Gutter Slope (%)	N/A		
	N/A	Gutter Ponding?	N/A	N/A	Gutter X Slope (%)	N/A		
	N/A	Gutter Lip Ht (in)	N/A	N/A	Painted X Walk2?	N/A		
	N/A	Painted X Walk1?	No	N/A	X Walk 2 Direction	N/A		
	N/A	X Walk 1 Direction	To N	N/A	X Walk 2 Width (in)	N/A		
	N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Slope (%)	N/A		
	N/A	X Walk 1 Slope (%)	5.2	N/A	X Walk 2 X Slope (%)	N/A		
	N/A	X Walk 1 X Slope (%)	6.1	N/A	Ramp inside XWalk2?	N/A		
	N/A	Ramp inside XWalk1?	N/A	N/A	Clear Space?	N/A		
	N/A	Road Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A		
Total Cost:	\$	1850.00	N/A	N/A	Storm Grate/Utility Hazard?	N/A		
					Storm Grate/Utility Type			
					Surface Condition? (G/P)	Good		

Total Cost: \$ 1850.00

