


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 27907	Main Street: BAY_HILL_CLUB_DR	Cross Street: COLONIAL_COUNTRY_LN	Location: NW
ADA ID: EE659BC9AA43	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

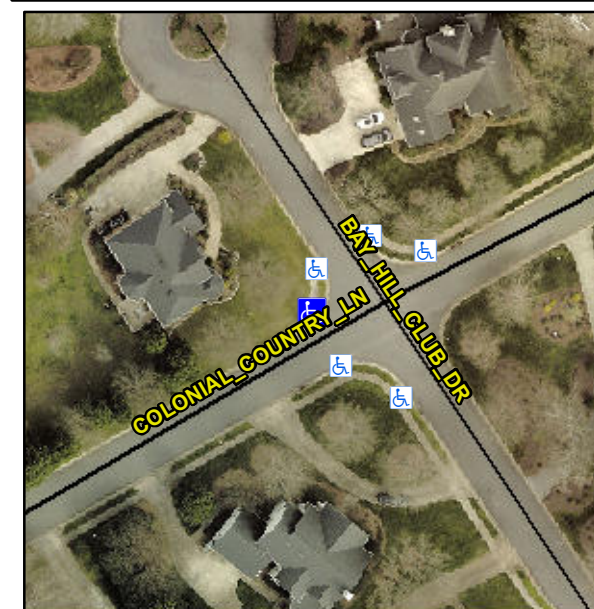

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305

Total Cost: \$ 1850.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	94.0	Yes	Ramp Slope (%)	5.1
Yes	Ramp Width (in)	64.0	Yes	Ramp XSlope (%)	1.2
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	1.1	N/A	Flare Slope RT (%)	0.9
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
No	Landing Length (in)	N/A	No	DWS Provided?	No
No	Landing Width (in)	N/A	N/A	DWS Contrast?	No
No	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	N/A	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.8
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.8
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SE		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.8		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.1		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

