

## **Access Compliance Report Public Rights-of-Way** (Curb Ramps)



Data

3.4

8.2

N/A

N/A

N/A N/A

N/A N/A

N/A N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A N/A

N/A

N/A

N/A

2.3

Good

Intersection ID: 14235 Main Street: CAMDEN RD **Cross Street: E TREMONT AV** Location: Ε Ramp Type: BlendTrans1 Initial Pass/Fail: Fail **Overall Compliance: No** 25 ADA ID: F1D8790AAFE0 **Severity Score:** 

Compliance Description

N/A

Yes

N/A

Ramp Length (in)

Ramp Width (in)

**Obstruction Type** 

Flare Type LT

**Codes/Mitigation Info/Possible Solution** 

## Field Measurements/Component Compliance

110.0 No

N/A N/A

Yes

Compliance Description

Flare Type RT

BlendTrans Slope (%)

BlendTrans XSlope (%)


Storm Grate/Utility Type

Surface Condition? (G/P)

Curb Slope (%)

Data

60.0

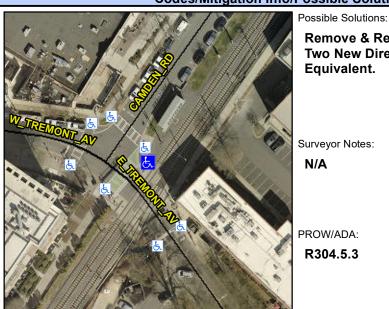

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3

Street 1 Name	E TREMONT AV
Stop Condition-Street 1	None
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Total Cost: 3200.00

	* .			,,
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?
N/A	Landing Length (in)	N/A	N/A	DWS Provided?
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)
N/A	Shared Landing?	N/A		
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?
	X Walk 1 Direction	To SW		X Walk 2 Direction
	X Walk 1 Width (in)	144.0		X Walk 2 Width (in)
	X Walk 1 Slope (%)	7.4		X Walk 2 Slope (%)
	X Walk 1 X Slope (%)	2.4		X Walk 2 X Slope (%)
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?
	Road Slope (%)	2.4		Clear Space?
	Road X Slope (%)	7.4	N/A	Clear Space to XWalk (in)
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?

N/A

Yes

N/A





